

Date Created : 2007/03/21
Date Issued On : 2007/04/18
PCN# : Q1071202

INFORMATION ONLY NOTIFICATION

This is to inform you that a minor change is being made to the following product(s). This notification is for your information only.

If you have any questions concerning this change, please contact:

Technical Contact:

Name: Patel, Rasik
E-mail: Rasik.Patel@fairchildsemi.com
Phone: 408-822-2564

PCN Originator:

Name: Principi, Fabio
E-mail: Fabio.Principi@fairchildsemi.com
Phone: 408 822 2565

Implementation of change:

Expected 1st Device Shipment Date: 2007/04/29

Earliest Year/Work Week of Changed Product: 0717

Change Type Description: Metallization Mask Revision

Description of Change (From): 1) Noise sensitivity causing logic errors. 2) Test program measure Ilim pin voltage at fixed Vcc 3) Third line top mark: C

Description of Change (To): 1) Add a noise filter in the logic block to reduce the sensitivity to noise. 2) Test program revised to insure stability of Ilim pin voltage versus Vcc. 3) Third line top mark: C1

Reason for Change : 1) Customer reported random shut-down of the FAN5069. 2) Customer reported false Ilim trips in the application. 3) To track "fixed" material

Product Id Description : PWM and LDO Controller Combo

Affected FSIDs :

FAN5069EMTCX	FAN5069MTCX	FAN5099M
FAN5099MTC	FAN5099MTCX	FAN5099MX