

PIC24FJ256GB110 Family Silicon Errata and Data Sheet Clarification

The PIC24FJ256GB110 family devices that you have received conform functionally to the current Device Data Sheet (DS39897C), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the PIC24FJ256GB110 family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (A5).

Data Sheet Clarifications and corrections start on page 11, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 2 or PICKIT™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 2 programmer/debugger or to the PICKIT 3.
2. From the main menu in MPLAB IDE, select *Configure>Select Device*, and then select the target part number in the dialog box.
3. Select the MPLAB IDE hardware tool (*Debugger>Select Tool*).
4. Perform a "Connect" operation to the device (*Debugger>Connect*). Depending on the development tool used, the part number *and* Device Revision ID value appear in the Output window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC24FJ256GB110 family silicon revisions are shown in [Table 1](#).

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾		Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾	
		A3	A5			A3	A5
PIC24FJ256GB110	101Fh	01h	03h	PIC24FJ128GB108	100Bh	01h	03h
PIC24FJ192GB110	1017h			PIC24FJ64GB108	1003h		
PIC24FJ128GB110	100Fh			PIC24FJ256GB106	1019h		
PIC24FJ64GB110	1007h			PIC24FJ192GB106	1011h		
PIC24FJ256GB108	101Bh			PIC24FJ128GB106	1009h		
PIC24FJ192GB108	1013h			PIC24FJ64GB106	1001h		

- Note 1:** The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format, "DEVID DEVREV".
- 2:** Refer to the "PIC24FJXXXGA0XX Flash Programming Specification" (DS39768) for detailed information on Device and Revision IDs for your specific device.

PIC24FJ256GB110 FAMILY

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions ⁽¹⁾	
				A3	A5
Core	RAM Operation	1.	Repeated register operations entering Doze mode	X	X
Core	BOR	2.	Spontaneous BOR with analog or USB peripherals	X	
JTAG	Device Programming	3.	Programming lockout during JTAG programming	X	X
UART	—	4.	Framing issues when using two Stop bits	X	
I/O	PORTB	5.	RB5 remains in high-impedance in Open-Drain mode	X	
SPI	Master mode	6.	SPIxIF and SPIRBF may be set early in some instances	X	
CTMU	—	7.	Trigger to IC or OC modules may not work	X	
USB	—	8.	Issue with Host mode, low-speed operation	X	X
USB	VUSB Regulator	9.	Does not regulate to 3.3V	X	X
USB	—	10.	CRC errors while using external transceiver	X	X
USB	—	11.	ACTIVIF flag functions only during Sleep	X	X
UART	UERIF Interrupt	12.	Interrupt may not function with multiple errors	X	
UART	FIFO Error	13.	PERR and FERR flags may be incorrect in certain cases	X	
UART	IrDA [®]	14.	Payload error in 8-bit mode	X	
UART	IrDA	15.	Framing error in 9-bit mode	X	
UART	IrDA	16.	Payload errors in 8-bit mode	X	
I ² C™ Module	Master mode	17.	Master module may Acknowledge its own transmission as a slave	X	
I ² C Module	Slave mode	18.	Module may not respond correctly to reserved addresses	X	
Memory	PSV	19.	False address error traps	X	
ICSP™	—	20.	PGEC3/PGED3 not functional	X	
Core	Instruction Set	21.	Issue with Read-After-Write stalls in REPEAT loops	X	X
RTCC	—	22.	Unexpected decrements of Alarm Repeat Counter	X	
SPI	Enhanced Buffer mode	23.	Issue with early full buffer interrupt	X	
A/D	—	24.	Disabled voltage references during Debug mode (64-pin devices only)	X	
SPI	Enhanced Buffer mode	25.	Issue with SRMPT bit becomes set early in certain cases	X	
Core	Code-Protect	26.	GCP disables write access to interrupt vectors	X	
CTMU	A/D Trigger	27.	Automatic conversion may not function	X	
Oscillator	LPRC	28.	Failure to restart following BOR events	X	
Oscillator	Two-Speed Start-up	29.	Feature is not functional.	X	X
Output Compare	—	30.	Single missed compare events under certain conditions.	X	
Interrupts	INTx	31.	External interrupts missed when writing to INTCON2.	X	X
A/D Converter	—	32.	Module continues to draw current when disabled.	X	X

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

PIC24FJ256GB110 FAMILY

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (A5).

1. Module: Core (RAM Operation)

If a RAM read is performed on the instruction immediately prior to enabling Doze mode, an extra read event may occur when Doze mode is enabled. This has no effect on most SFRs and on user RAM space. However, this could cause registers which also perform some action on a read (such as auto-incrementing a pointer or removing data from a FIFO buffer) to repeat that action, possibly resulting in lost data or unexpected operation.

Work around

Avoid reading registers which perform a secondary action (e.g., UART and SPI FIFO buffers, and the RTCVAL registers) immediately prior to entering Doze mode.

If this cannot be avoided, execute a NOP instruction before entering Doze mode.

Affected Silicon Revisions

A3	A5						
X	X						

2. Module: Core (BOR)

When the on-chip regulator is enabled (ENVREG tied to VDD), a BOR event may spontaneously occur under the following circumstances:

- VDD is less than 2.5V, and either:
- the internal band gap reference is being used as a reference with the A/D Converter (AD1PCFG2<1> or <0> = 1) or comparators (CMxCON<1:0> = 11); or
- the CTMU or the USB module is enabled.

Work around

Limit the following activities to only those times when the on-chip regulator is not in Tracking mode (LVDIF (IFS4<8>) = 0):

- Enabling the USB or CTMU modules
- Selecting the internal band gap as a reference for the A/D Converter or the comparators

Affected Silicon Revisions

A3	A5						
X							

3. Module: JTAG (Device Programming)

The JTAGEN Configuration bit can be programmed to '0' while using the JTAG interface for device programming. This may cause a situation where JTAG programming can lock itself out of being able to program the device.

Work around

None.

Affected Silicon Revisions

A3	A5						
X	X						

4. Module: UART

When the UART is operating using two Stop bits (STSEL = 1), it may sample the first Stop bit instead of the second one. If the device being communicated with is one using one Stop bit in its communications, this may lead to framing errors.

Work around

None.

Affected Silicon Revisions

A3	A5						
X							

5. Module: I/O (PORTB)

When RB5 is configured as an open-drain output, it remains in a high-impedance state. The settings of LATB5 and TRISB5 have no effect on the pin's state.

Work around

If open-drain operation is not required, configure RB5 as a regular I/O (ODCB<5> = 0).

If open-drain operation is required, there are two options:

- Select a different I/O pin for the open-drain function
- Place an external transistor on the pin and configure the pin as a regular I/O

Affected Silicon Revisions

A3	A5						
X							

PIC24FJ256GB110 FAMILY

6. Module: SPI (Master Mode)

In Master mode, both the SPI Interrupt Flag (SPIxIF) and the SPIRBF bit (SPIxSTAT<0>) may become set one-half clock cycle early, instead of on the clock edge. This occurs only under the following circumstances:

- Enhanced Buffer mode is disabled (SPIBEN = 0)
- The module is configured for serial data output changes on transition from clock active to clock Idle state (CKE = 1)

If the application is using the interrupt flag to determine when data to be transmitted is written to the transmit buffer, the data currently in the buffer may be overwritten.

Work around

Before writing to the SPI buffer, check the SCK pin to determine if the last clock edge has passed.

[Example 1](#) (below) demonstrates a method for doing this. In this example, pin, RD1, functions as the SPI clock, SCK, which is configured as Idle low.

Affected Silicon Revisions

A3	A5						
X							

7. Module: CTMU

When the CTMU module is selected as the trigger source (SYNCSEL<4:0> = 11000), the output compare or input capture module triggers may not work.

Work around

Manually trigger the output compare and/or input capture modules after a CTMU event is received. Be certain to compensate for any time latency required by manually triggering the module.

Affected Silicon Revisions

A3	A5						
X							

8. Module: USB

While operating in Host mode and attached to a low-speed device through a full-speed USB hub, the PRE signal may not be generated correctly. This will result in not being able to communicate correctly with the low-speed device.

Work around

Connect low-speed devices directly to the application and not through a USB hub.

Affected Silicon Revisions

A3	A5						
X	X						

9. Module: USB (VUSB Regulator)

The USB internal voltage regulator does not regulate to 3.3V. The USB internal voltage regulator is an optional feature and is not required for USB operation or compliance.

Work around

Disable the USB voltage regulator (DISUVREG Configuration bit set to '1') and supply 3.0V to 3.6V from an external source to the VUSB pin.

Affected Silicon Revisions

A3	A5						
X	X						

10. Module: USB

When the module is configured to use an external transceiver, the CRC5 value of some packets may be incorrect.

Work around

Use the module's internal transceiver.

Affected Silicon Revisions

A3	A5						
X	X						

EXAMPLE 1: CHECKING THE STATE OF SPIxIF AGAINST THE SPI CLOCK

```

while(IFS0bits.SPI1IF == 0){} //wait for the transmission to complete
while(PORTDbits.RD1 == 1){} //wait for the last clock to finish
SPI1BUF = 0xFF; //write new data to the buffer
    
```

PIC24FJ256GB110 FAMILY

11. Module: USB

The Bus Activity Interrupt Flag, ACTVIF, is active only while the device is in Sleep mode. It will not become set when the microcontroller is in a Run mode.

Work around

The type of work around depends on the type of application that the microcontroller is being used for.

For Self-Powered Peripherals: After receiving a Suspend command from the PC, do NOT suspend or disable the USB module. In addition, do not switch to a clock configuration that is incompatible with USB operation (refer to the device data sheet for USB compatible clock settings).

For Bus Powered Peripherals: After receiving a suspend command from the PC (IDLEIF Interrupt Flag = 1):

- Suspend the USB module (U1PWRC<1> = 1)
- Globally enable USB interrupts (IEC5<6> = 1)
- Specifically enable the bus activity interrupt (U1OTGIE<4> = 1)
- Place the microcontroller into Sleep mode as soon as possible

For Embedded Host Devices:

- Issue a suspend command to the peripheral device
- Suspend the USB module (U1PWRC<1> = 1)
- Globally enable USB interrupts (IEC5<6> = 1)
- Place the microcontroller into Sleep mode as soon as possible

As an alternate procedure, do NOT suspend or disable the USB module and do not switch to a clock configuration that is incompatible with USB operation.

Affected Silicon Revisions

A3	A5							
X	X							

12. Module: UART (UERIF Interrupt)

The UART error interrupt may not occur, or occur at an incorrect time, if multiple errors occur during a short period of time.

Work around

Read the error flags in the UxSTA register whenever a byte is received to verify the error status. In most cases, these bits will be correct, even if the UART error interrupt fails to occur. For possible exceptions, refer to Errata # 13.

Affected Silicon Revisions

A3	A5							
X								

13. Module: UART (FIFO Error Flags)

Under certain circumstances, the PERR and FERR error bits may not be correct for all bytes in the receive FIFO. This has only been observed when both of the following conditions are met:

- The UART receive interrupt is set to occur when the FIFO is full or ¾ full (UxSTA<7:6> = 1x)
- More than 2 bytes with an error are received

In these cases, only the first two bytes with a parity or framing error will have the corresponding bits indicate correctly. The error bits will not be set after this.

Work around

None.

Affected Silicon Revisions

A3	A5							
X								

14. Module: UART (IrDA®)

When the UART is operating in 8-bit mode (PDSEL<1:0> = 0x) and using the IrDA endec (IREN = 1), the module incorrectly transmits a data payload of 80h as 00h.

Work around

None.

Affected Silicon Revisions

A3	A5							
X								

PIC24FJ256GB110 FAMILY

15. Module: UART (IrDA)

When the UART is operating in 8-bit mode (PDSEL<1:0> = 0x) and using the IrDA endec (IREN = 1), a framing error may occur when transmitting a data payload of 00h.

Work around:

None.

Affected Silicon Revisions

A3	A5						
X							

16. Module: UART (IrDA)

When the UART is operating in 9-bit mode (PDSEL<1:0> = 1x) and using the IrDA endec (IREN = 1), the module will incorrectly transmit 10 bits when transmitting data payloads of 00h or 80h.

Work around:

None.

Affected Silicon Revisions

A3	A5						
X							

17. Module: I²C™ Module (Master Mode)

Under certain circumstances, a module operating in Master mode may Acknowledge its own command addressed to a slave device. This happens when the following occurs:

- 10-Bit Addressing mode is used (A10M = 1)
- The I²C Master has the same two upper address bits (I2CADD<9:8>) as the addressed slave module

In these cases, the Master also Acknowledges the address command and generates an erroneous I²C slave interrupt, as well as the I²C master interrupt.

Work around

Several options are available:

- When using 10-Bit Addressing mode, make certain that the master and slave devices do not share the same 2 MSBs of their addresses.

If this cannot be avoided:

- Clear the A10M bit (I2CxCON<10> = 0) prior to performing a Master mode transmit.
- Read the ADD10 bit (I2CxSTAT<8>) to check for a full 10-bit match whenever a slave I²C interrupt occurs on the master module.

Affected Silicon Revisions

A3	A5						
X							

18. Module: I²C Module (Slave Mode)

Under certain circumstances, a module operating in Slave mode, may not respond correctly to some of the special addresses reserved by the I²C protocol. This happens when the following occurs:

- 10-Bit Addressing mode is used (A10M = 1)
- Bits, A<7:1>, of the slave address (I2CADD<7:1>) fall into the range of the reserved 7-bit address ranges: '1111xxx' or '0000xxx'.

In these cases, the Slave module Acknowledges the command and triggers an I²C slave interrupt; it does *not* copy the data into the I2CxRCV register or set the RBF bit.

Work around

Do not set bits, A<7:1>, of the module's slave address equal to '1111xxx' or '0000xxx'.

Affected Silicon Revisions

A3	A5						
X							

PIC24FJ256GB110 FAMILY

19. Module: Memory (Program Space Visibility)

When accessing data in the PSV area of data RAM, it is possible to generate a false address error trap condition by reading data located precisely at the lower address boundary (8000h). If data is read using an instruction with an auto-decrement, the resulting RAM address will be below the PSV boundary (i.e., at 7FFEh); this will result in an address error trap.

This false address error can also occur if a 32-bit MOV instruction is used to read the data at location, 8000h.

Work around

Do not use the first location of the PSV page (address 8000h). The MPLAB C Compiler (v3.11 or later) supports the option, "-merrata=psv_trap", to prevent it from generating code that would cause this erratum.

Affected Silicon Revisions

A3	A5							
X								

20. Module: ICSP™

The ICSP/ICD port pair, PGEC3/PGED3 (RB5/RB4), cannot be used to read or program the device.

Work around

Use either PGEC2/PGED2 or PGEC1/PGED1.

Affected Silicon Revisions

A3	A5							
X								

21. Module: Core (Instruction Set)

If an instruction producing a Read-After-Write stall condition is executed inside a REPEAT loop, the instruction will be executed fewer times than was intended. For example, this loop:

```
repeat #0xF
inc [w1],[++w1]
```

will execute less than 15 times.

Work around

Avoid using REPEAT to repetitively execute instructions that create a stall condition. Instead, use a software loop using conditional branches. The MPLAB C Compiler will not generate REPEAT loops that cause this erratum.

Affected Silicon Revisions

A3	A5							
X	X							

22. Module: RTCC

Under certain circumstances, the value of the Alarm Repeat Counter (ALCFGRPT<7:0>) may be unexpectedly decremented. This happens only when a byte write to the upper byte of ALCFGRPT is performed in the interval between a device POR/BOR, and the first edge from the RTCC clock source.

Work around

Do not perform byte writes on ALCFGRPT, particularly the upper byte.

Alternatively, wait until one period of the SOSC has completed before performing byte writes to ALCFGRPT.

Affected Silicon Revisions

A3	A5							
X								

PIC24FJ256GB110 FAMILY

23. Module: SPI (Enhanced Buffer Modes)

If the SPI event interrupt is configured to occur when the enhanced FIFO buffer is full (SISEL<2:0> = 111), the interrupt may actually occur when the 7th byte is written to the buffer, instead of the 8th byte. The other enhanced buffer interrupts function as previously described.

Work around

Do not use the Full Buffer Interrupt mode. The SPITBF bit (SPIxSTAT<1>) reliably indicates when the enhanced FIFO buffer is full and can be polled instead of using the Full Buffer Interrupt mode.

Affected Silicon Revisions

A3	A5						
X							

24. Module: A/D Converter

When using PGEC1 and PGED1 to debug an application on any 64-pin devices in this family, all voltage references will be disabled. This includes VREF+, VREF-, AVDD and AVSS. Any A/D conversion will always equal 0x3FF.

Note: This issue only applies to 64-pin devices in this family (PIC24FJ256GB106, PIC24FJ192GB106, and PIC24FJ64GB106).

Work around

Use PGEC2 and PGED2 to debug any A/D functionality.

Affected Silicon Revisions

A3	A5						
X							

25. Module: SPI (Enhanced Buffer Mode)

In Enhanced Master mode, the SRMPT bit (SPIxSTAT<7>) may erroneously become set for several clock cycles in the middle of a FIFO transfer, indicating that the shift register is empty when it is not. This happens when both SPI clock prescalers are set to values other than their maximum (SPIxCON<4:2> ≠ 000 and SPIxCON<1:0> ≠ 00).

Work around

Set SISEL<2:0> (SPIxSTAT<4:2>) to '101'. This configures the module to generate an SPI event interrupt whenever the last bit is shifted out of the shift register. When the SPIxIF flag becomes set, the shift register is empty.

Affected Silicon Revisions

A3	A5						
X							

26. Module: Core (Code Protection)

When general segment code protection has been enabled (GCP Configuration bit is programmed), applications are unable to write to the first 512 bytes of the program memory space (0000h through 0200h). In applications that may require the interrupt vectors to be changed during run time, such as bootloaders, modifications to the Interrupt Vector Tables (IVT) will not be possible.

Work around

Create two new Interrupt Vector Tables, one each for the IVT and AIVT, in an area of program space beyond the affected region. Map the addresses in the old vector tables to the new tables. These new tables can then be modified as needed to the actual addresses of the ISRs.

Affected Silicon Revisions

A3	A5						
X							

27. Module: CTMU (A/D Trigger)

The CTMU may not trigger an automatic A/D conversion after the current source is turned off. This happens even when the A/D trigger control bit, CTRRIG (CTMUCON<8>), has been set.

Work around

Perform a manual A/D conversion by clearing the SAMP bit (AD1CON1<1>) immediately after the CTMU current source has been stopped.

Affected Silicon Revisions

A3	A5						
X							

PIC24FJ256GB110 FAMILY

32. Module: A/D Converter

Once the A/D module is enabled (AD1CON1<15> = 1), it may continue to draw extra current even if the module is later disabled (AD1CON1<15> = 0).

Work around

In addition to disabling the module through the ADON bit, set the corresponding PMD bit (ADC1MD, PMD1<0>) to power it down completely.

Disabling the A/D module through the PMD register also disables the AD1PCFG registers, which in turn affects the state of any port pins with analog inputs. Users should consider the effect on I/O ports and other digital peripherals on those ports when ADC1MD is used for power conservation.

Affected Silicon Revisions

A3	A5						
X	X						

PIC24FJ256GB110 FAMILY

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS39897C):

Note: Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

1. Module: Guidelines for Getting Started with 16-Bit Microcontrollers

Section 2.4 Voltage Regulator Pins (ENVREG/DISVREG and VCAP/VDDCORE) has been replaced with a new and more detailed section. The entire text follows:

2.4 Voltage Regulator Pins Voltage Regulator Pins (ENVREG/DISVREG and VCAP/VDDCORE)

Note: This section applies only to PIC24FJ devices with an on-chip voltage regulator.

The on-chip voltage regulator enable/disable pin (ENVREG or DISVREG, depending on the device family) must always be connected directly to either a supply voltage or to ground. The particular connection is determined by whether or not the regulator is to be used:

- For ENVREG, tie to VDD to enable the regulator, or to ground to disable the regulator
- For DISVREG, tie to ground to enable the regulator or to VDD to disable the regulator

Refer to **Section 26.2 “On-Chip Voltage Regulator”** for details on connecting and using the on-chip regulator.

When the regulator is enabled, a low-ESR (< 5Ω) capacitor is required on the VCAP/VDDCORE pin to stabilize the voltage regulator output voltage. The VCAP/VDDCORE pin must not be connected to VDD and must use a capacitor of 10 μF connected to ground. The type can be ceramic or tantalum. Suitable examples of capacitors are shown in **Table 2-1**. Capacitors with equivalent specifications can be used.

Designers may use **Figure 2-3** to evaluate ESR equivalence of candidate devices.

The placement of this capacitor should be close to VCAP/VDDCORE. It is recommended that the trace length not exceed 0.25 inch (6 mm). Refer to **Section 29.0 “Electrical Characteristics”** for additional information.

When the regulator is disabled, the VCAP/VDDCORE pin must be tied to a voltage supply at the VDDCORE level. Refer to **Section 29.0 “Electrical Characteristics”** for information on VDD and VDDCORE.

FIGURE 2-3 FREQUENCY vs. ESR PERFORMANCE FOR SUGGESTED VCAP

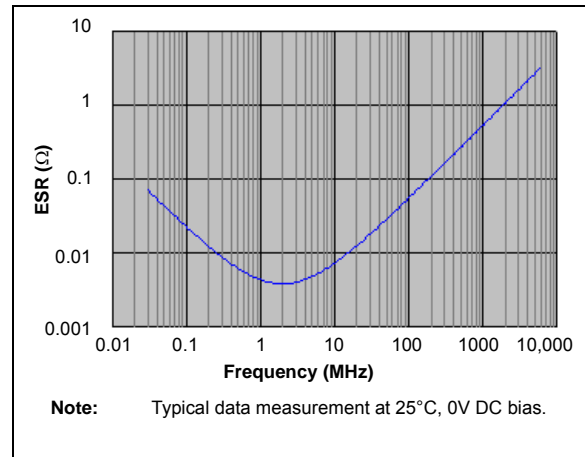


TABLE 2-1 SUITABLE CAPACITOR EQUIVALENTS

Make	Part #	Nominal Capacitance	Base Tolerance	Rated Voltage	Temp. Range
TDK	C3216X7R1C106K	10 μF	±10%	16V	-55 to 125°C
TDK	C3216X5R1C106K	10 μF	±10%	16V	-55 to 85°C
Panasonic	ECJ-3YX1C106K	10 μF	±10%	16V	-55 to 125°C
Panasonic	ECJ-4YB1C106K	10 μF	±10%	16V	-55 to 85°C
Murata	GRM32DR71C106KA01L	10 μF	±10%	16V	-55 to 125°C
Murata	GRM31CR61C106KC31L	10 μF	±10%	16V	-55 to 85°C

PIC24FJ256GB110 FAMILY

2.4.1 CONSIDERATIONS FOR CERAMIC CAPACITORS

In recent years, large value, low-voltage, surface mount ceramic capacitors have become very cost effective in sizes up to a few tens of microfarad. The low-ESR, small physical size and other properties make ceramic capacitors very attractive in many types of applications.

Ceramic capacitors are suitable for use with the internal voltage regulator of this microcontroller. However, some care is needed in selecting the capacitor to ensure that it maintains sufficient capacitance over the intended operating range of the application.


Typical low-cost 10 μF ceramic capacitors are available in X5R, X7R and Y5V dielectric ratings (other types are also available, but are less common). The initial tolerance specifications for these types of capacitors are often specified as $\pm 10\%$ to $\pm 20\%$ (X5R and X7R), or $-20\%/+80\%$ (Y5V). However, the effective capacitance that these capacitors provide in an application circuit will also vary based on additional factors, such as the applied DC bias voltage and the temperature. The total in-circuit tolerance is, therefore, much wider than the initial tolerance specification.

The X5R and X7R capacitors typically exhibit satisfactory temperature stability (ex: $\pm 15\%$ over a wide temperature range, but consult the manufacturer's data sheets for exact specifications). However, Y5V capacitors typically have extreme temperature tolerance specifications of $+22\%/ -82\%$. Due to the extreme temperature tolerance, a 10 μF nominal rated Y5V type capacitor may not deliver enough total capacitance to meet minimum internal voltage regulator stability and transient response requirements. Therefore, Y5V capacitors are not recommended for use with the internal voltage regulator if the application must operate over a wide temperature range.

In addition to temperature tolerance, the effective capacitance of large value ceramic capacitors can vary substantially, based on the amount of DC voltage applied to the capacitor. This effect can be very significant, but is often overlooked or is not always documented.

A typical DC bias voltage vs. capacitance graph for 16V, 10V and 6.3V rated capacitors is shown in Figure 2-4.

FIGURE 2-4 DC BIAS VOLTAGE vs. CAPACITANCE CHARACTERISTICS

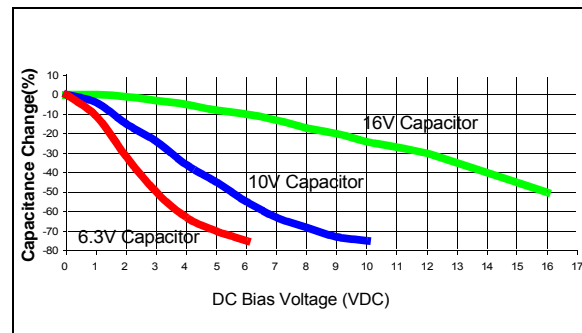

When selecting a ceramic capacitor to be used with the internal voltage regulator, it is suggested to select a high-voltage rating, so that the operating voltage is a small percentage of the maximum rated capacitor voltage. For example, choose a ceramic capacitor rated at 16V for the 2.5V core voltage. Suggested capacitors are shown in Table 2-1.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev A Document (2/2008)

Original version of this document, for silicon revision A3. Includes silicon issues 1 (Core, RAM Operation), 2 (Core, BOR), 3 (JTAG, Programming), 4 (UART), 5 (I/O, PORTB), 6 (SPI, Master Mode), 7 (Input Capture) and 8 through 11 (USB).

Rev B Document (7/2008)

Revised silicon issues 4 (UART) and 6 (SPI, Master Mode) to reflect updated definition of issues. Added to revision A3: silicon issues 12 (UART, UERIF Interrupt), 13 (UART, FIFO Error Flags), 14 through 16 (UART, IrDA), 17 (I²C, Master Mode), 18 (I²C, Slave Mode), 19 (Memory, Program Space Visibility), 20 (ICSP), 21 (Core, Instruction Set), 22 (RTCC), 23 (SPI, Enhanced Buffer Modes) and 24 (A/D Converter).

Rev C Document (10/2008)

Added silicon issue 25 (SPI – Enhanced Buffer Mode) to revision A3.

Rev D Document (1/2009)

Added silicon issue 26 (Core – Code Protection) to revision A3.

Rev E Document (5/2009)

Added silicon issues 27 (CTMU – A/D Trigger) and 28 (Oscillator – LPRC) to revision A3. Ported document to unified silicon errata/data sheet clarification format.

Rev F Document (7/2009)

Added silicon revision A5 to document. Includes existing silicon issues 1 (Core, RAM Operation), 3 (JTAG, Programming), 8 through 11 (USB) and 21 (Core, Instruction Set). No additional new issues added.

Rev G Document (02/2010)

Added silicon issue 29 (Oscillator – Two-Speed Start-up) to silicon revisions A3 and A5.

Rev H Document (06/2010)

Added silicon issues 30 (Output Compare) and 31 (Interrupts – INTx) to silicon revisions A3 and A5.

Rev J Document (07/2010)

Added silicon issue 32 (A/D Converter) to silicon revisions A3 and A5.

Rev K Document (09/2010)

Revised silicon issue 32 (A/D Converter) to reflect updated definition of issues. Added data sheet clarification issue 1 (Guidelines For Getting Started with 16-Bit Microcontrollers).

PIC24FJ256GB110 FAMILY

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC³² logo, rPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniscient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICkit, PICTail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2010, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 978-1-60932-487-2

Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

**QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==**

