



## dsPIC33FJ256GPX06A/X08A/X10A Family Silicon Errata and Data Sheet Clarification

The dsPIC33FJ256GPX06A/X08A/X10A family devices that you have received conform functionally to the current Device Data Sheet (DS70593B), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. The silicon issues are summarized in Table 2.

The errata described in this document will be addressed in future revisions of the dsPIC33FJ256GPX06A/X08A/X10A silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of Table 2 apply to the current silicon revision (A3).

Data Sheet clarifications and corrections start on page 5, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 2 or PICkit™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 2 programmer/debugger or PICkit 3.
2. From the main menu in MPLAB IDE, select *Configure>Select Device*, and then select the target part number in the dialog box.
3. Select the MPLAB hardware tool (*Debugger>Select Tool*).
4. Perform a "Connect" operation to the device (*Debugger>Connect*). Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various dsPIC33FJ256GPX06A/X08A/X10A silicon revisions are shown in Table 1.

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision <sup>(2)</sup>	
		A2	A3
dsPIC33FJ256GP506A	0x07F5	0x3002	0x3003
dsPIC33FJ256GP510A	0x07F7		
dsPIC33FJ256GP710A	0x07FF		

- Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.
- 2:** Refer to the "dsPIC33F/PIC24H Flash Programming Specification" (DS70152) for detailed information on Device and Revision IDs for your specific device.

# dsPIC33FJ256GPX06A/X08A/X10A

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>	
				A2	A3
ECAN	WAKIF bit	1.	The WAKIF bit in the CxINTF register cannot be cleared by software instruction after the device is interrupted from Sleep due to activity on the CAN bus.	X	X
ECAN	DMA	2.	False DMA Error Traps may be generated in applications that perform both transmissions and receptions using ECAN with DMA.	X	
UART	Break Characters	3.	The UART module will not generate consecutive break characters.	X	X
ADC	DONE bit	4.	The ADC Conversion Status bit (DONE) does not work when External Interrupt is selected as the ADC trigger source.	X	X
SPI	TBF bit	5.	Writing to the SPIBUF register as soon as the TBF bit is cleared will cause the SPI module to ignore the written data.	X	X
DMA Controller	CPU Write Collision Detection	6.	DMA CPU write collisions will not be detected.		X
ADC	Current Consumption in Sleep Mode	7.	If the ADC module is in an enabled state when the device enters Sleep Mode, the power-down current (IPD) of the device may exceed the device data sheet specifications.	X	X
All	150°C Operation	8.	Affected revisions of silicon only support 140°C operation instead of 150°C for extended operating temperature.	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

# dsPIC33FJ256GPX06A/X08A/X10A

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A3**).

### 1. Module: ECAN

The WAKIF bit in the CxINTF register cannot be cleared by software instruction after the device is interrupted from Sleep due to activity on the CAN bus.

When the device wakes up from Sleep due to CAN bus activity, the ECAN module is placed in operational mode. The ECAN Event interrupt occurs due to the WAKIF flag. Trying to clear the flag in the Interrupt Service Routine (ISR) may not clear the flag. The WAKIF bit being set will not cause repetitive Interrupt Service Routine execution.

#### Work around

Although the WAKIF bit does not clear, the device Sleep and ECAN Wake functions continue to work as expected. If the ECAN event is enabled, the CPU will enter the Interrupt Service Routine due to the WAKIF flag getting set. The application can maintain a secondary flag, which tracks the device Sleep and Wake events.

#### Affected Silicon Revisions

A2	A3						
X	X						

### 2. Module: ECAN

In user applications that perform both transmissions and receptions using ECAN with DMA, intermittent DMA Write Collisions might get generated, resulting in the generation of DMA Error Traps. The ECAN messages would be transmitted and received correctly even when these DMA Error Traps occur.

#### Work around

Within the DMA Error Trap service routine in the application software, read the DMACS0 register and inspect the two XWCOLn (n = 0, 1, ...,7) bits corresponding to the DMA channels being used for ECAN transmission and reception.

For example, if DMA Channel 1 is used for ECAN Reception and DMA Channel 2 is used for ECAN Transmission, inspect the XWCOL1 and XWCOL2 bits. If either of these bits is found to be set, clear the DMACERR bit in the INTCON1 register and return from the DMA Error Trap service routine.

#### Affected Silicon Revisions

A2	A3						
X							

### 3. Module: UART

The UART module will not generate consecutive break characters. Trying to perform a back-to-back Break character transmission will cause the UART module to transmit the dummy character used to generate the first Break character instead of transmitting the second Break character. Break characters are generated correctly if they are followed by non-Break character transmission.

#### Work around

None.

#### Affected Silicon Revisions

A2	A3						
X	X						

# dsPIC33FJ256GPX06A/X08A/X10A

## 4. Module: ADC

The ADC Conversion Status (DONE) bit (ADxCON1<0>) does not indicate completion of conversion when External Interrupt is selected as the ADC trigger source (ADxCON1<SSRC> = 1).

### Work around

Use an ADC interrupt or poll ADxIF bit in the IFSx registers to determine the completion of conversion.

### Affected Silicon Revisions

A2	A3							
X	X							

## 5. Module: SPI

Writing to the SPIxBUF register as soon as the TBF bit is cleared will cause the SPI module to ignore the written data. *Applications that use SPI with DMA are not affected by this erratum.*

### Work around

After the TBF bit is cleared, wait for a minimum duration of one SPI clock before writing to the SPIxBUF register.

Alternately, do one of the following:

- Poll the RBF bit and wait for it to get set before writing to the SPIxBUF register
- Poll the SPI Interrupt flag and wait for it to get set before writing to the SPIxBUF register
- Use an SPI Interrupt Service Routine
- Use DMA

### Affected Silicon Revisions

A2	A3							
X	X							

## 6. Module: DMA Controller

DMA CPU write collisions will not be detected, and the corresponding XWCOLn bit (n = 0, 1, ..., 7) will not be set. As a result, a CPU write collision event will not generate a DMA Error Trap.

### Work around

None. Before writing to any memory location in DMA RAM, ensure that none of the enabled DMA channels is using the same memory location for data transfers from a peripheral.

### Affected Silicon Revisions

A2	A3							
	X							

## 7. Module: ADC

If the ADC module is in an enabled state when the device enters Sleep mode as a result of executing a PWRSAV #0 instruction, the device power-down current (IPD) may exceed the specifications listed in the device data sheet. This may happen even if the ADC module is disabled by clearing the ADON bit prior to entering Sleep mode.

### Work around

In order to remain within the IPD specifications listed in the device data sheet, the user software must completely disable the ADC module by setting the ADC Module Disable bit in the corresponding Peripheral Module Disable register (PMDx), prior to executing a PWRSAV #0 instruction.

### Affected Silicon Revisions

A2	A3							
X	X							

## 8. Module: All

The affected silicon revisions listed below are not warranted for operation at 150°C.

### Work around

Only use the affected revisions of silicon for Hi-Temp operating range from -40°C to +140°C.

### Affected Silicon Revisions

A2	A3							
X	X							

# dsPIC33FJ256GPX06A/X08A/X10A

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS70593B):

**Note:** Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

### 1. Module: DC Characteristics: I/O Pin Input Specifications

The maximum value for parameter DI19 ( $V_{IL}$  specifications for SDAx and SCLx pins) was stated incorrectly in Table 25-9 of the current device data sheet. Also, parameters DI28 and DI29 ( $V_{IH}$  specifications for SDAx and SCLx pins) were not stated. The correct values are shown in bold type in [Table 3](#).

**TABLE 3: DC CHARACTERISTICS: I/O PIN INPUT SPECIFICATIONS**

DC CHARACTERISTICS		Standard Operating Conditions: 3.0V to 3.6V (unless otherwise stated) Operating temperature $-40^{\circ}\text{C} \leq T_A \leq +85^{\circ}\text{C}$ for Industrial $-40^{\circ}\text{C} \leq T_A \leq +125^{\circ}\text{C}$ for Extended					
Param No.	Symbol	Characteristic	Min	Typ	Max	Units	Conditions
DI18	$V_{IL}$	Input Low Voltage					
		<b>SDAx, SCLx</b>	$V_{SS}$	—	$0.3 V_{DD}$	V	SMBus disabled
DI19		<b>SDAx, SCLx</b>	$V_{SS}$	—	<b>0.8</b>	V	SMBus enabled
DI28	$V_{IH}$	Input High Voltage					
		<b>SDAx, SCLx</b>	<b><math>0.7 V_{DD}</math></b>	—	<b>5.5</b>	V	<b>SMBus disabled</b>
DI29		<b>SDAx, SCLx</b>	<b>2.1</b>	—	<b>5.5</b>	V	<b>SMBus enabled</b>

# dsPIC33FJ256GPX06A/X08A/X10A

---

## APPENDIX A: REVISION HISTORY

### Rev A Document (9/2009)

Initial release of this document; issued for revision A2 silicon.

Includes silicon issues 1-2 ([ECAN](#)), 3 ([UART](#)), 4 ([ADC](#)) and 5 ([SPI](#)).

### Rev B Document (12/2009)

Added silicon issue 6 ([DMA Controller](#)).

### Rev C Document (6/2010)

Added silicon issue 7 ([ADC](#)) and data sheet clarification 1 ([DC Characteristics: I/O Pin Input Specifications](#)).

### Rev D Document (9/2010)

Added silicon issue 8 ([All](#)).

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC<sup>32</sup> logo, rPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniscient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICkit, PICTail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2010, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 978-1-60932-492-6

*Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC<sup>®</sup> MCUs and dsPIC<sup>®</sup> DSCs, KEELOQ<sup>®</sup> code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*

**QUALITY MANAGEMENT SYSTEM  
CERTIFIED BY DNV  
== ISO/TS 16949:2002 ==**



# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://support.microchip.com>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Cleveland**  
Independence, OH  
Tel: 216-447-0464  
Fax: 216-447-0643

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Kokomo**  
Kokomo, IN  
Tel: 765-864-8360  
Fax: 765-864-8387

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8528-2100  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Chongqing**  
Tel: 86-23-8980-9588  
Fax: 86-23-8980-9500

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444  
Fax: 91-80-3090-4123

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-6578-300  
Fax: 886-3-6578-370

**Taiwan - Kaohsiung**  
Tel: 886-7-213-7830  
Fax: 886-7-330-9305

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820

08/04/10