

# Errata on AT91SAM9G45 Engineering Sample Devices

## 1. Scope

This document describes the known errata found on Atmel's AT91 ARM® Thumb®-based Microcontroller series **AT91SAM9G45** device engineering samples with a date code prior to 0927.

 
It applies to devices:

- AT91SAM9G45 (with marking: CU-ES)

### 1.1 Marking

All devices are marked with the Atmel logo and the ordering code.

Additional marking is as follows:



where

- “YY”: manufactory year
- “WW”: manufactory week
- “V”: revision
- “XXXXXXXXX”: lot number



## AT91 ARM Thumb-based Microcontrollers

### AT91SAM9G45

## Errata Sheet

6485B-ATARM-28-Sep-09



## 2. Errata

### 2.1 DDRSDRAM Controller (DDRSDRC)

#### 2.1.1 DDRSDRC: DDR2 Multi-port Read Optimization

Read optimization does not work for the multi-port DDR2. This feature is enabled by default in the DDRSDRC\_HS register at offset 0x2C in the DDRSDRC user interface.

##### **Problem Fix/Workaround**

Read optimization must be disabled by software by setting the DIS\_ANTICIP\_READ bit.

### 2.2 Error Corrected Code Controller (ECC)

#### 2.2.1 ECC: Computation with a 1 clock cycle long NRD/NWE pulse

If the SMC is programmed with NRD/NWE pulse length equal to 1 clock cycle, HECC cannot compute the parity.

##### **Problem/Fix Workaround**

It is recommended to program SMC with a value superior to 1.

### 2.3 Internal Memory

#### 2.3.1 ROM Code: SAM-BA<sup>®</sup> through USB

The connection through USB to the SAM-BA monitor does not work.

##### **Problem Fix/Workaround**

Use JTAG or serial port to communicate with SAM-BA monitor.


Note: See the steps described below.

#### 2.3.2 AT91SAM9G45-ES ROM Code Replacement

Procedure to install AT91SAM9G45-ES ROM code replacement:

Prior to any operation, the user needs to install *AT91-ISP.exe 1.13* and unzip [AT91SAM9G45\\_RomCode\\_Replacement.zip](#) file that contains a version of ROM binary code with USB issue fixed. Check and conform to the following Default Jumpers Settings.

Figure 2-1. Default Jumpers Settings

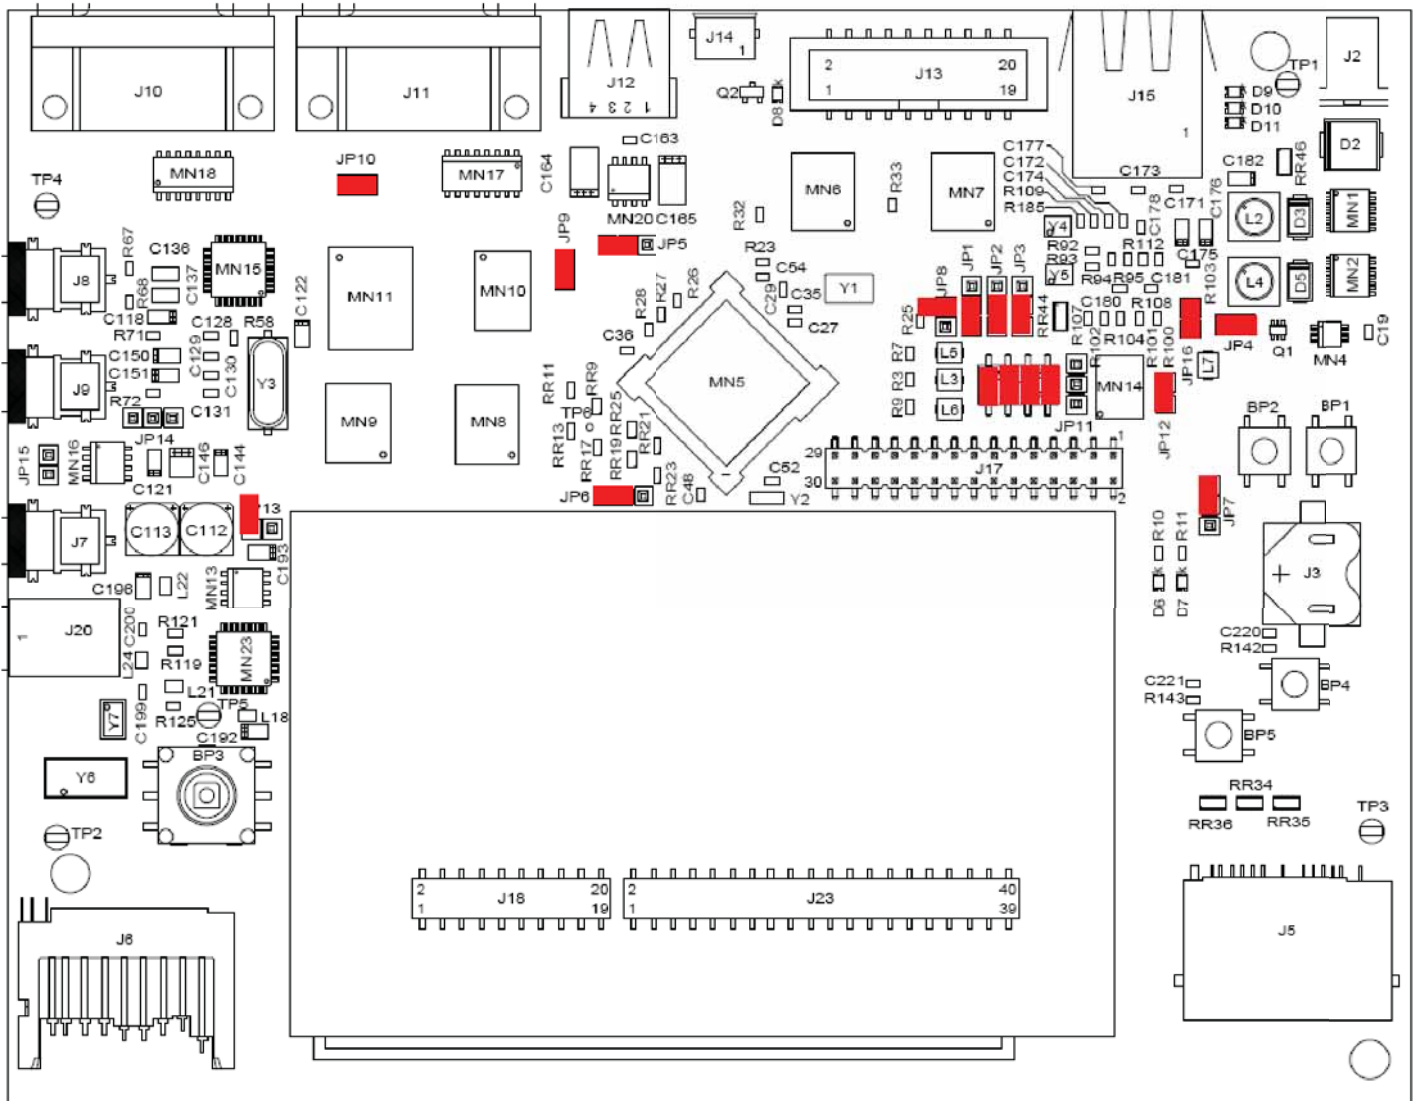

Once done, the following steps are necessary to store this version of ROM code in DataFlash.

1. unplug power supply
2. unplug USB device cable
3. remove jumper JP10 (NandFlash Chip Select) & JP12 (DataFlash Chip Select)
4. plug serial cable
5. launch hyper terminal (115,200 bauds, 8 bits, parity none, 1 stop bit, no flow control)
6. plug-in power supply
7. type on hyper terminal: "Alt-0128 Alt-0128 #"
8. AT91SAM9G45-EKES returns ">"
9. close hyper terminal
10. close jumper JP12 (DataFlash® Chip Select)
11. launch SAM-BA (Choose right COM port and AT91SAM9G45-EKES)
12. choose DataFlash media tab in the SAM-BA GUI interface

13. initialize DataFlash, choosing the Enable action in the Scripts rolling menu and press Execute
14. choose Send boot file, press Execute
15. select *AT91SAM9G45\_RomCode\_Replacement.bin* binary file and press Open; the media is written down
16. close SAM-BA

On Reset, the faulty ROM code will copy the fixed ROM code in SRAM and launch it. The connexion through USB to the SAM-BA monitor will work.

Note: Boot from DataFlash media will no longer be available for other purpose.

### 2.3.3 ROM Code: SDCARD

SDCARD boot is not supported.

#### Problem Fix/Workaround

None

## 2.4 Image Sensor Interface (ISI)

### 2.4.1 ISI: Codec Path is disabled

The ISI Codec path is disabled after the capture of each frame and so requires to be enabled before the capture of the next frame. This may lead to discarding some frames if the frame rate is high.

#### Problem Fix/Workaround

None

## 2.5 LCD Controller (LDC)

### 2.5.1 LDC: LCD formula to compute LCD Pixel Clock

The LCD formula to compute the LCD pixel clock is  $\text{system\_clock}/2*(\text{CLKVAL}+1)$  instead of  $\text{system\_clock}/(\text{CLKVAL}+1)$ .

#### Problem Fix/Workaround

None

## 2.6 High Speed MultiMedia Card Interface (HSMCI)

### 2.6.1 HSMCI: R1B Busy Timing

Busy line is sampled 2 clock cycles after the command End Bit when the R1B response type is expected.

This timing is not strictly defined in SD mode.

This timing is defined in MMC Specification V4.3. (R1B busy Timing)

#### Problem/Fix Workaround

The user must poll the D0 (busy line) through the PIO Controller and wait for a rising edge on that line.

## 2.7 Pulse Width Modulation Controller (PWM)

### 2.7.1 PWM: Zero Period

It is impossible to update a period equal to 0 by using the PWM\_CUPD register.

#### Problem/Fix Workaround

None

## 2.8 Reset Controller (RSTC)

### 2.8.1 RSTC: NRST Signal, input mode not available at startup

The NRST input mode power-up is not available at reset. The NRST mode is output at power-up.

#### Problem Fix/Workaround

None

## 2.9 Serial Synchronous Controller (SSC)

### 2.9.1 SSC: Clock is Transmitted before the SSC is enabled

SSC configuration:

- Performs a SW reset,
- Program the receive and the transmit frame synchro,
- Program the transmit and the receive clock as continuous (CKO = Continuous Receive and Transmit Clock)

=> the clock is transmitted.

#### Problem Fix/Workaround

Configure PIO lines for SSC usage after first enabling the SSC.

### 2.9.2 SSC: Last RK Clock Cycle when RK Outputs a Clock during data transfer

When the SSC receiver is used with the following conditions:

- the internal clock divider is used (CKS = 0 and DIV different from 0)
- RK pin set as output and provides the clock during data transfer (CKO = 2)
- data sampled on RK falling edge (CKI = 0)

At the end of the data cycle, the RK pin is set in high impedance which might be seen as an unexpected clock cycle.

#### Problem Fix/Workaround

Enable the pull-up on RK pin.

### 2.9.3 SSC: First RK Clock Cycle when RK Outputs a Clock during data transfer

When the SSC receiver is used with the following conditions:

- RX clock is divided clock (CKS = 0 and DIV different from 0)
- RK pin set as output and provides the clock during data transfer (CKO = 2)
- data sampled on RK falling edge (CKI = 0)

The first clock cycle time generated by the RK pin is equal to  $MCK / (2 \times (\text{value} + 1))$ .

### **Problem Fix/Workaround**

None.

#### **2.9.4 SSC: Data sent without any frame synchro**

When SSC is configured with the following conditions:

- RF is in input,
- TD is synchronized on a receive START (any condition: START field = 2 to 7)
- TF toggles at each start of data transfer
- Transmit STTDLY = 0
- Check TD and TF after a receive START,

The data is sent but there is not any toggle of the TF line

### **Problem Fix/Workaround**

Transmit STTDLY must be different from 0.

#### **2.9.5 SSC: Unexpected delay on TD output**

When SSC is configured with the following conditions:

- TCMR.STTDLY more than 0
- RCMR.START = Start on falling edge/Start on Rising edge/Start on any edge
- RFMR.FSOS = None (input)
- TCMR.START = Receive Start

Unexpected delay of 2 or 3 system clock cycles is added to TD output.

### **Problem Fix/Workaround**

None

## **2.10 USB Host Port (UHP)**

### **2.10.1 UHP: OHCI Mode not functional**

The USB Host Port does not work in OHCI mode.

### **Problem Fix/Workaround**

None

## **2.11 USB High Speed Device Port (UDPHS)**

### **2.11.1 UDPHS and UPHS shared UTMI transceiver**

The switch allowing to share a UTMI transceiver between the host port and the device port works only when switching from host to device. It does not work when switching from device to host.

### **Problem Fix/Workaround**

None

## 2.12 Universal Synchronous Asynchronous Receiver Transmitter (USART)

### 2.12.1 USART: RX impossible after any TX in ISO7816 mode T1

Reception is impossible after any transmission in ISO7816 mode T1.

#### **Problem/Fix Workaround**

Configure USART in ISO7816 Mode T0 + INACK = 1 in US\_MR during the reception. Once reception is done, i.e. when the PDC Interruption ENDRX is received, reconfigure the USART in Mode T1 in US\_MR prior to transmitting.

### 2.12.2 USART: Bad value in Number of Errors Register

The Number of Errors Register (US\_NER) always returns 0 instead of the ISO7816 error number.

#### **Problem/Fix Workaround**

None

## Revision History

| Doc. Rev | Comments   | Change Request Ref. |
|----------|--|---------------------|
| 6485B    | Figure 2-1 “Default Jumpers Settings” on page 3 added. | 6678                |
|          | “MMC boot” removed from Section 2.3.3 on page 4.       | 6643                |
| 6485A    | First issue  |                     |







## Headquarters

---

**Atmel Corporation**  
2325 Orchard Parkway  
San Jose, CA 95131  
USA  
Tel: 1(408) 441-0311  
Fax: 1(408) 487-2600

## International

---

**Atmel Asia**  
Unit 1-5 & 16, 19/F  
BEA Tower, Millennium City 5  
418 Kwun Tong Road  
Kwun Tong, Kowloon  
Hong Kong  
Tel: (852) 2245-6100  
Fax: (852) 2722-1369

**Atmel Europe**  
Le Krebs  
8, Rue Jean-Pierre Timbaud  
BP 309  
78054 Saint-Quentin-en-  
Yvelines Cedex  
France  
Tel: (33) 1-30-60-70-00  
Fax: (33) 1-30-60-71-11

**Atmel Japan**  
9F, Tonetsu Shinkawa Bldg.  
1-24-8 Shinkawa  
Chuo-ku, Tokyo 104-0033  
Japan  
Tel: (81) 3-3523-3551  
Fax: (81) 3-3523-7581

## Product Contact

---

**Web Site**  
[www.atmel.com](http://www.atmel.com)  
[www.atmel.com/AT91SAM](http://www.atmel.com/AT91SAM)

**Technical Support**  
[AT91SAM Support](mailto:AT91SAM_Support@atmel.com)  
[Atmel technical support](mailto:ATmel_technical_support@atmel.com)

**Sales Contacts**  
[www.atmel.com/contacts/](http://www.atmel.com/contacts/)

**Literature Requests**  
[www.atmel.com/literature](http://www.atmel.com/literature)

---

**Disclaimer:** The information in this document is provided in connection with Atmel products. No license, express or implied, by estoppel or otherwise, to any intellectual property right is granted by this document or in connection with the sale of Atmel products. **EXCEPT AS SET FORTH IN ATMEL'S TERMS AND CONDITIONS OF SALE LOCATED ON ATMEL'S WEB SITE, ATMEL ASSUMES NO LIABILITY WHATSOEVER AND DISCLAIMS ANY EXPRESS, IMPLIED OR STATUTORY WARRANTY RELATING TO ITS PRODUCTS INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR NON-INFRINGEMENT. IN NO EVENT SHALL ATMEL BE LIABLE FOR ANY DIRECT, INDIRECT, CONSEQUENTIAL, PUNITIVE, SPECIAL OR INCIDENTAL DAMAGES (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF PROFITS, BUSINESS INTERRUPTION, OR LOSS OF INFORMATION) ARISING OUT OF THE USE OR INABILITY TO USE THIS DOCUMENT, EVEN IF ATMEL HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.** Atmel makes no representations or warranties with respect to the accuracy or completeness of the contents of this document and reserves the right to make changes to specifications and product descriptions at any time without notice. Atmel does not make any commitment to update the information contained herein. Unless specifically provided otherwise, Atmel products are not suitable for, and shall not be used in, automotive applications. Atmel's products are not intended, authorized, or warranted for use as components in applications intended to support or sustain life.



© 2009 Atmel Corporation. All rights reserved. Atmel®, Atmel logo and combinations thereof, DataFlash®, SAM-BA® and others are registered trademarks or trademarks of Atmel Corporation or its subsidiaries. ARM®, the ARMPowered® Logo are registered trademarks of ARM Ltd. Other terms and product names may be trademarks of others.