# Checktemp1

# Checktemp1

# Checktemp1


Checktemp 1 🧷 Celsius Model

Checktenp 1 CAN Celsius Model with Factory Calibration Certificate

Checktemp 1 F Fahrenheit Model

Checktenp 1 F/N Fahrenheit Model with Factory Calibration Certificate



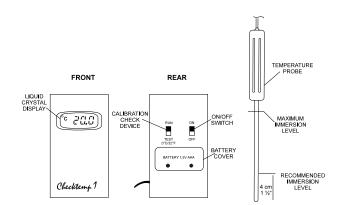

#### SPECIFICATIONS:

#### Range

Checktemp 1  $\boldsymbol{\mathcal{C}}$ -50.0 to 150.0℃

Checktemp 1  ${\bf \emph{F}}$ -58.0 to 302°F

Resolution

Checktenp 1 C

Checktemp 1 F 0.1°F (-58.0 to 199.9°F) 1°F (200 to 302°F)

Accuracy (020°C/68°F)

Checktemp 1 **C** ±0.3°C (-20 to 90°C) ±0.5°C (outside)

Checktemp 1 F ±0.5°F (-4 to 194°F)

±1°F (outside)

### Typical EMC Deviation

Checktemp 1  $\boldsymbol{\mathcal{C}}$ ±0.3℃ Checktemp 1 F ±0.5°F

**Environment** 0 to 50°C (32 to 122°F); 95% RH max.

Battery Type 1 x 1.4V alkaline

Life approx. 3,000 hours

of continuous use

106 x 58 x 19 mm Dimensions

(4.2 x 2.2 x 0.7")

Weight 80 g (2.8 oz.) Probe Stainless steel,

160mm x 3mm Ø

with 1 meter (3.3') cable

## Checktemp1

### Checktemp1

### Checktemp1

#### OPERATION:

- Turn Checktemp 1 on.
- Dip Checktempl probe in sample. An immersion level of 4 cm (1 ½") is rec- ${\tt ommended.}$
- Do NOT immerse the probe handle.
- Do NOT wrench the probe or put heavy objects on the cable. If the cable is damaged, the meter needs to be replaced.
- ·Wait for a few seconds for the display to stabilize and switch the meter off when not in use.
- · Variations in readings or fading display can indicate a weak battery.

#### CALIBRATION CHECK SWITCH:


Move the Cal-check switch down. The display should show 0.0°C ±0.3°C Or 32°F ±0.5°F. MEASUREN MODE Contact your dealer or your nearest Hanna Service Center for



recalibration, if necessary. Move the Cal-check switch back up. The display returns to measurement mode.

### BATTERY REPLACEMENT:

When the Checktemp 1 cannot be switched on or the display fades, remove the two screws, open the

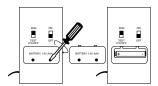

battery cover and change the 1.4V AAA battery, paying attention to its polarity. Replace the cover and tighten the two screws. Battery should only be replaced in a safe area using the battery type specified in this instruction sheet.

SIGCESTIONS FOR USERS;
Before using this product, make are that it is entirely suitable for the environment in which it is used operation of this instrument in measurable are could variation introduced by the user to the supplied equipment may degrade the instrument's EMC performance. To avoid electrical shocks, do not use this instrument when voltage at the measurement surface exceeds 24 VAC or 60 VAC. To avoid damage or burns, do not perform any measurement in microwave overs.

Visit our Internet Home Page: http://www.henneinst.com

