DCF-S-0033-1(95.5)


									3 0000	.,,,,,
Japan Aviation Electronics Industry, Ltd. Precision Manufacturing Equipment Division			Num	ber	т.	700	230E	5	Page 1 / 9	
Spec:					inal	issued:	NOV. 17	, 2000		
TITLE: Operation Manual for			Rev.		Date	CN-No.	Prep	Chkd	Appd	
	CT150-4C-1LZ		2	Ser	.7.2001	48728	Kawano	K. Loid	Almanh	
ISSUED: P	roduction Equ	uipment & To	oling Dept.							
Prepared	Checked	Approved	PL Approved							
F.Kawano	K.Koide	A.Iwasaki	Kums							




CAUTION

- Be sure to read this manual before operation since all safety precautions are described in this manual.
- Properly keep this operation manual near the tool so that anyone can refer to them at anytime.
- Be sure to use the hand tool by following the instructions given in this operation manual. Otherwise, we will not be responsible for any accidents that may result.

This Hand crimping tool is used for crimping stripped wires to contacts. To obtain excellent crimped wires, be sure to read this manual carefully in order to fully understand this tool and operate it correctly.

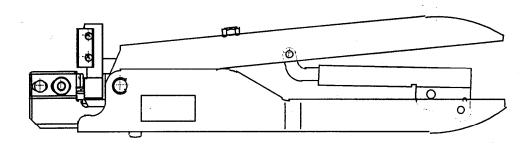




Japan Aviation Electronics Industry, Ltd.

Precision Manufacturing Equipment Division

T700230E

Page
2/9

Important Safeguards and Precautions

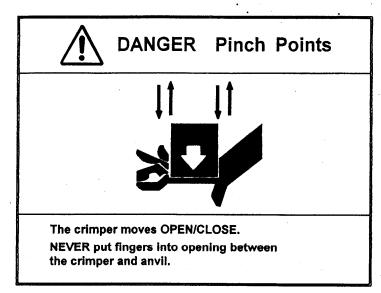

About caution symbols:

In this manual and on our products as well, the following caution symbols are used to show important information and warnings for correct use of our products. This is to avoid possible personal injury and property damage. Be sure to read and understand these special instructions before proceeding to the procedural details.



DANGER

A danger indicates an operation that results in serious personal injury or fatal wound if precautions are not followed.



WARNING

A warning indicates an operation that could cause serious personal injury or fatal wound if precautions are not followed.



CAUTION

A caution indicates an operation that could cause personal injury or equipment damage if precautions are not followed.

Examples of caution symbols:



An equilateral triangle \triangle serves the same as CAUTION (or DANGER and WARNING).



コネクチは指導で


It contains a specific warning information inside (the lightning flash with arrowhead symbol shown left means a risk of electric shock to persons).

A no entry mark \square indicates an action that must be prohibited. Inside or near it is indicated a special instruction (the label shown left means prohibition of disassembly).

A black circle • indicates a required action that must be proceeded without failure. It contains specific instructions inside (the label shown left me ans required disconnection of a plug from an outlet).


Japan Aviation Electronics Industry, Ltd.		Number	T700230E	Page 3/9
Precision Manufacturing Equipment	Division			

1. Tool Name CT150-4C-ILZ

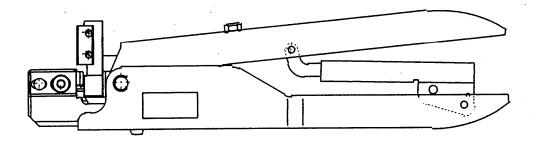

2. Notes on Handling this Tool

- ① Do not crimp other than specified contacts and wires.
- ② To keep this tool in good working condition for a long period of time, always keep it clean and handle it with care. Avoid dropping or handling it roughly.
- The handle is adjusted so that the claw of ratchet is released when crimping is completed.
 Do not release the handle before crimping is completed.
- 4 It is not necessary to lubricate the crimper or anvil.
- (5) When using this tool, be sure to check that the contact crimp height meets the specified conditions.
- ®This tool has two crimping sections, so select a proper one taking wire size into account.

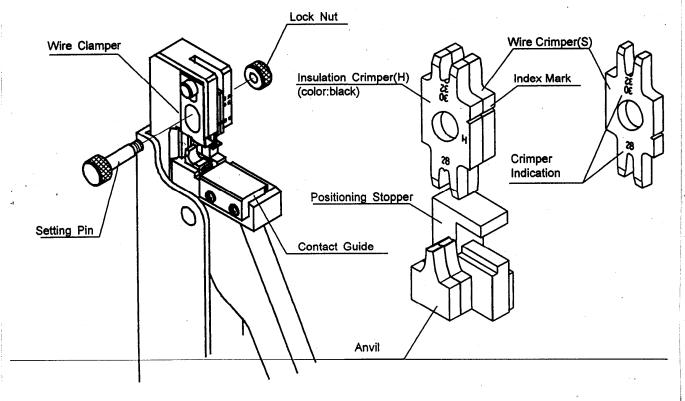

Japan Aviation Electronics Industry, Ltd.	. . Number	T700230E	Page 4/9
Precision Manufacturing Equipment	Division		

4. Preoperation

4-1 Striping wire

Strip the specified length of insulation off each wire first. At this time, check that no cuts or flaws exist in the conductor and correct any disarrangement of the wire ends before starting to crimp.

4-2 Setting up Crimper

①Handles Release

Before inserting a contact into the tool, release the handle. The contact cannot be inserted if the handle is not released. To release the handle, grip it tightly until the ratchet is release.

②Setting up Crimper

The wire crimper have two kinds of crimp cavities up and down sides.

Set it up according to the applicable wire.(see Table II)

Caution: Set up the wire crimper and the insulation crimper together with the wire size of the wire crimper indication out side.

3Check The Crimper Setting

Make sure to put the marks of the wire crimper and insulation crimper together.

(4) Changing Wire Crimper

Unscrew the lock nut and take off the setting pin to remove

the wire crimper and the insulation crimper.

Fix the appropriate side of the wire crimper

in the tool body for the applicable wire before operating this tool.

Make sure the procedure of setting up the wire crimper

and Insulation crimper or their tops.

Set up the Insulation crimper (color:black) in front side of this tool. Set up the index mark(Insulation crimper"H"&wire size,


Setting Pin


Wire crimper"S"&wire size)is outside of this tool.


Insert the setting pin into the wire clamper and the tool body.

Then fasten the lock nut.

(Lock nut is able to fasten manually)

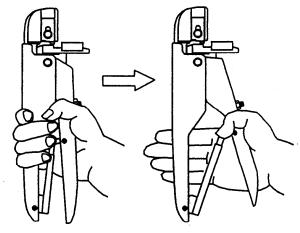

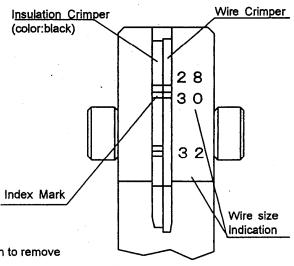


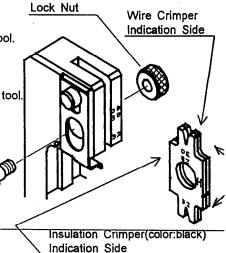

Japan Aviation Electronics Industry, Ltd.	Number	T700230E	Page 5/9
Precision Manufacturing Equipment	Division		

4-3 Setting up contact

Install the insulation barrel of the reel contact which is cut about 100mm to 150mm into the contact guide until the contact side touches the positioning stopper.

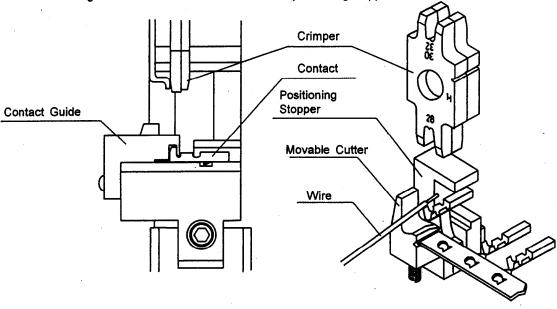

5.Operation

5-1 Preparation

Insert the conductor into the opening space between crimpers and anvil, and put the wire on the cutter. Then strike the tip of it slightly against the positioning stopper. It may happen that the tip of wire strikes too strongly against the positioning stopper and the crimping become rejected with bending it.


To maintain the situation, make sure to crimp with the wire being set on the anvil.

5-2Crimping

Squeeze the handle gradually to the stroke end with holding the wire in place.

Then, crimping is done and the ratchet is released.

the crimper and anvil.



Japan Aviation Electronics Industry, Ltd.		. • Number	T700230E	Page 6/9	
Precision Manufacturing Equipment	Division			٠,	

5-3Taking out the product

After crimping, the handle shall be let back to the opening position of itself, and take out the product that is crimped contact with wire.

Note: When you repeat crimping with same size cable, shift the contact by one pitch with hand, and operate in accordance with the above procedure (paragraph 4-1 thru 4-3).


6. Check of the crimped contact

This paragraph provides only rejected crimping peculiar to IL-Z Series contacts, an extra from IL-Z Series Connector Assembly Manual No. T87-5.

For product check other than crimping, see IL-Z Series Connector Assembly Manual No. T87-5.

Rejected Crimped Contact:

1) Declined insulation barrel, Bell-mouth

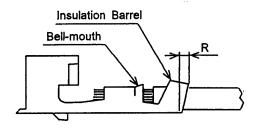


The dimension "R" of the declined insulation barrel is more than 0.5 mm.

Bell-mouth(not crimped part) length is outside of range.


(The range of Bell-mouth: 0.05~1.15)

2) Longer insulation stripped length

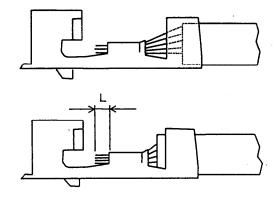

As the insulation stripped length is longer than the specified one, the insulation is inserted into half length of the insulation barrel only, or the dimension "L" is more than 0.6 mm.


3) Bend of contact



The bend "0" of a contact is more than 3' against the upper part of the mating portion of the contact as a basis.


Japan Aviation Electronics Industry, Ltd.		Number	T700230E	Page 7/9
Precision Manufacturing Equipment	Division			

5) Twisted contact



The degree, wire barrel is twisted against the mating portion, is more than 10° in all directions.

6) Bend-up and Bend-down, Carrier residuum

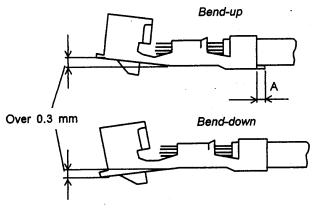


Based from the wire crimped portion, the bend-up amount or the bend-down amount of the mating tip is no less than 0.3 mm.

The carrier cut residuum "A" is more than 0.1 mm.

iv) Deviation of insulation barrel

Deviation of insulation barrel is greater than half of barrel length.



7. Check of crimp height

When this tool is delivered, the crimp height has already been adjusted.

However, it may be due to the use for a long time that they can be out of adjustment.

Please make sure that crimp height of crimped contact is in the specified value shown in the next chapter.

DCF-S-0033-2(95.5)

Japan Aviation Electronics Industry, Ltd.		Number	T700230E	Page 8/9
Precision Manufacturing Equipment	Division			"

8. Applicable contact and cable and tool description

Table I

(Dimension: mm)


	Applicable Wire					
Applicable Contact	Cable Size (AWG#)	Stranding	Outer Diameter of Insulation			
IL-Z-C3-A- 15000	28 30 32	Stranded 7 conductors	φ0.5~φ1.0			


Table II

(Dimension: mm)

Applicable	Applicable Wire			Tool Indication		Standerd for crimp height	
Applicable Contact	Wire Size (AWG#)	Outside Diameter of insulation	Stripped Length	Wire Crimper	Insulation Crimper	Conducter ±0.02(mm)	Insulation ±0.1(mm)
	28	φ0.7~φ1.0	1.5~1.9	28	28	0.58	1.30
IL-Z-C3-A		φ 0.5 ~φ 0.8			30.32		1.10
-15000	30~32	φ 0.7 ~φ 1.0		30 32	28	0.54	1.30
		φ 0.5 ~φ 0.8			30.32		1.10

- Note 1. Select wire and insulation crimper according to applicable cable size.
- Note 2. Applicable wire is stranded 7 conductors. Using not specified wire, please ask us whether the wire is usable or not.

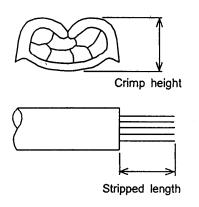

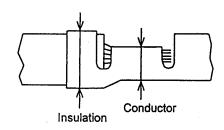

DCF-S-0033-2(95.5)

Japan Aviation Electronics Industry, Ltd.		Number	T700230E	Page 9/9
Precision Manufacturing Equipment	Division			0, 0

9. Crimp Strength

The tensile strength when the conductor part of a wire is crimped is the crimping strength. When crimping is done accurately with this tool, the crimping strength meets the specifications shown in the table blow:

Wire Size (AWG)	#32	#30	#28
Crimping Strength	5.8N	9.8N	13.7N