


HAND CRIMP TOOL Specification Sheet Order No. 63819-1100

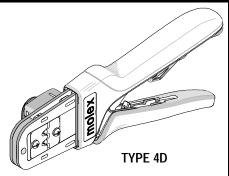

FEATURES


- A full cycle ratcheting hand tool ensures complete crimps
- Ergonomic soft grip handles for comfortable crimping
- A precision user-friendly terminal locator wire stop holds terminals in the proper crimping position
- Right and Left handed applications
- This tool is WHMA-IPCA620 Class 2 compliant as indicated
- This tool is RoHS compliant, however RoHS compliant is not required

SCOPE

Products: 2.36mm (.093") Diameter, Standard .093" Pin and Socket Crimp Terminals, 14-20 AWG, 3.18mm (.125") Diameter, Standard .125" Pin and Socket Crimp Terminals, 16-18 AWG, and Commoning Terminals, 14-16 AWG.

Terminal	Terminal Terminal Order			Wi	re Size	🔒 Insulatio	on Diameter	Strip Length	
Series No.	Loose	Piece	+ Reel	AWG	mm²	mm In.		mm	In.
	02-09-1103	39-00-0288			2.08-0.52	1.65-4.06	.065160	3.30-3.80	.130150
	02-09-1104	39-00-0289		14-20					
1189	02-09-5106	39-00-0294							
	02-09-5111	39-00-0295							
	39-00-0072								
1190	02-09-2103	39-00-0297			2.08-0.52	1.65-4.06	.065160	3.30-3.80	
	02-09-6106	39-00-0299		14-20					.130150
	02-09-6110								
1457-2	05-02-0050		05-02-0049	14-16	2.08-1.31	3.56 Max.	.140 Max.	3.30-3.80	.130150
1973-2	02-09-8109			14-18	2.08-0.82	4.06 Max.	.160 Max.	3.30-3.80	.130150
2046	18-12-2222			16-18	1.31-0.82	3.05 Max.	.120 Max.	3.30-3.80	.130150
2047	18-12-1222			16-18	1.31-0.82	3.05 Max.	.120 Max.	3.30-3.80	.130150
4549	02-09-2167			14-20	2.08-0.52	3.56 Max.	.140 Max.	3.30-3.80	.130150
4550	02-09-1206	02-09-5170		14-20	2.08-0.52	3.56 Max.	.140 Max.	3.30-3.80	.130150
7238	02-09-1112			14-18	2.08-0.82	3.56 Max.	.140 Max.	3.60-4.10	.140160
+ Customer to cut off terminal from reel: 0.18mm (.007") maximum Cut-off Tab.									
See Conditions on page 3.									

Doc No: ATS-638191100 Revision: A Release Date: 01-09-08 Revision Date: 01-09-08

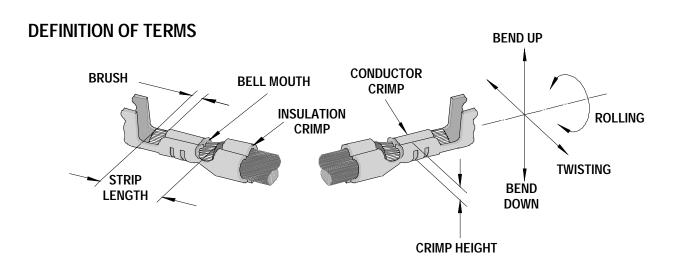

The above terminal drawing is a generic terminal representation. It is not an image of a terminal listed in the scope.

CONDITIONS:

After crimping, the conductor profiles should measure the following.

Terminal Series No	Wire Size		Co	imp		Insulation Crimp				
Terminal Series NO	AWG	mm ²	Height (Ref.)		Width (Ref.)		Height (Ref.)		Width (Ref.)	
1189	14	2.08	1.62 - 1.72	.064068	2.36	.093	3.25	.128	3.50	.138
	16	1.31	1.46 – 1.56	.057061	2.36	.093	3.09	.122	3.43	.135
1107	18	0.82	1.35 – 1.45	.053057	2.08	.082	2.74	.108	3.09	.122
	20	0.52	1.30 – 1.40	.051055	2.08	.082	2.65	.104	3.02	.119
	14	2.08	1.62 - 1.72	.064068	2.36	.093	3.25	.128	3.50	.138
1190	16	1.31	1.46 – 1.56	.057061	2.36	.093	3.09	.122	3.43	.135
1170	18	0.82	1.35 – 1.45	.053057	2.08	.082	2.74	.108	3.09	.122
	20	0.52	1.30 – 1.40	.051055	2.08	.082	2.65	.104	3.02	.119
1457-2	14	2.08	1.62 - 1.72	.064068	2.40	.094	3.25	.128	3.53	.139
1437 2	16	1.31	1.52 – 1.62	.060064	2.35	.093	3.16	.124	3.48	.137
	14	2.08	1.62 – 1.72	.064068	2.39	.094	3.23	.127	3.50	.138
1973-2	16	1.31	1.52 – 1.62	.060064	2.35	.093	3.15	.124	3.44	.135
	18	0.82	1.37 – 1.47	.054058	2.09	.082	2.76	.109	3.07	.121
2046	16	1.31	1.65 – 1.75	.065069	2.38	.094	3.30	.130	3.55	.140
2040	18	0.82	1.57 – 1.67	.062066	2.34	.092	3.19	.126	3.47	.137
2047	16	1.31	1.65 – 1.75	.065069	2.38	.094	3.30	.130	3.55	.140
2047	18	0.82	1.57 – 1.67	.062066	2.34	.092	3.19	.126	3.47	.137
	14	2.08	1.57 - 1.67	.062066	2.39	.094	3.20	.126	3.49	.137
4549	16	1.31	1.46 – 1.56	.057061	2.35	.093	3.10	.122	3.46	.136
4347	18	0.82	1.33 – 1.43	.052056	2.08	.082	2.72	.107	3.08	.121
	20	0.52	1.25 – 1.35	.049053	2.07	.081	2.65	.104	3.00	.118
	14	2.08	1.57 - 1.67	.062066	2.39	.094	3.20	.126	3.49	.137
4550	16	1.31	1.46 – 1.56	.057061	2.35	.093	3.10	.122	3.46	.136
4000	18	0.82	1.33 – 1.43	.052056	2.08	.082	2.72	.107	3.08	.121
	20	0.52	1.25 – 1.35	.049053	2.07	.081	2.65	.104	3.00	.118
	14	2.08	1.69 – 1.79	.067070	2.40	.094	3.24	.128	3.51	.138
7238	16	1.31	1.65 – 1.75	.065069	2.38	.094	3.24	.128	3.51	.138
	18	0.82	1.59 – 1.69	.063067	2.37	.093	3.18	.125	3.46	.136

Doc No: ATS-638191100 Revision: A Release Date: 01-09-08 Revision Date: 01-09-08

Terminal Series No	Wire Size		PULL Force Min.		Profile		Locator	
	AWG	mm ²	Ν	Lb.	Α	В	Order No.	Color
	14	2.08	178.0	40.00	Х	<u> </u>	63819-1175	
1189	16	1.31	155.0	35.00	Х			Red
1107	18	0.82	111.3	25.00		Х		Reu
	20	0.52	66.8	15.00		Х		
	14	2.08	178.0	40.00	Х			Red
1190	16	1.31	155.0	35.00	Х		63819-1175	
1190	18	0.82	111.3	25.00		Х	03019-1175	Reu
	20	0.52	66.8	15.00		Х		l
1457-2	14	2.08	178.0	40.00	Х		63819-1176	Yellow
1457-2	16	1.31	155.0	35.00	Х		03019-1170	Tellov
	14	2.08	178.0	40.00	Х		63819-1176	Yellow
1973-2	16	1.31	155.0	35.00	Х			
	18	0.82	111.3	25.00		Х		
201/	16	1.31	155.0	35.00	Х	<u> </u>	63819-1177	Gray
2046	18	0.82	111.3	25.00	Х			
20.47	16	1.31	155.0	35.00	Х	1	63819-1177	Gray
2047	18	0.82	111.3	25.00	Х			
	14	2.08	178.0	40.00	Х	1	63819-1175	Red
4549	16	1.31	155.0	35.00	Х			
4049	18	0.82	111.3	25.00		Х		
	20	0.52	66.8	15.00		Х		
	14	2.08	178.0	40.00	Х	1	63819-1175	Red
4550	16	1.31	155.0	35.00	Х			
4000	18	0.82	111.3	25.00		Х		
	20	0.52	66.8	15.00		Х		
	14	2.08	178.0	40.00	Х	[63819-1175	Red
7238	16	1.31	155.0	35.00	Х			
	18	0.82	111.3	25.00	Х			
Jo Achieve IPC-A-6	20 Class					wire in:	sulation diamete	er range
				mended:		• • - ·		
				- 2.20mm				
	2. F	vrofile B:	2.85mm	-1.70mm	(.112 -	.067 IN	cn)	

OPERATION

CAUTION: Install only Molex terminals listed above with this tool. Do not crimp hardened objects as damage can occur to the tool or die.

Open the tool by squeezing the handles together. At the end of the closing stroke, the ratchet mechanism will release the handles and the hand tool will spring open. See Figure 1.

Crimping Terminals

1. Select the desired terminal listed from the preceding charts and install the proper locator (See chart above and see Locator Installation on page 5).

HANDLE WILL SPRING OPEN

SQUEEZE

HANDLES

TOGETHER


Figure 1

M


Molex

Doc No: ATS-638191100 Revision: A Release Date: 01-09-08 Revision Date: 01-09-08

2. Make sure the center of the locator is in the down position. With the locator attached, push the locator button on the back of the hand tool to bring the locator forward through the tooling. See Figure 2.

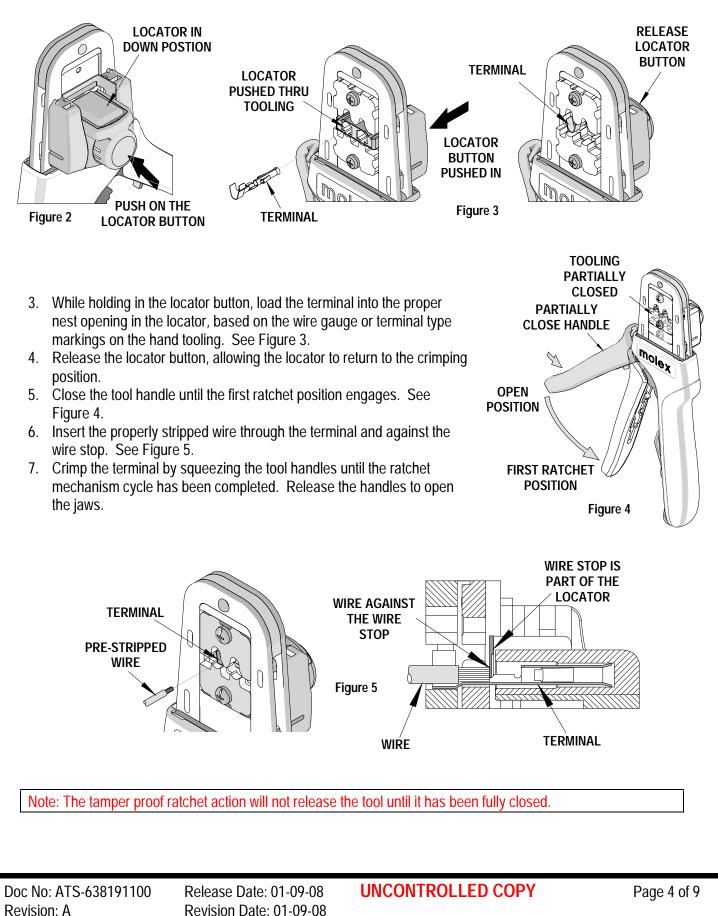

- 8. Remove the crimped terminal from the terminal locator by pulling on the wire.
- 9. Visually inspect the crimped terminal for proper crimp location.
- On some large O.D. wires, it may not be possible to insert the wire with the tool partially closed. Those wires should be inserted with the hand tool in the open position. Insert the wire above the terminal in the punch and against the wire stop then close the tool. See Figure 6.

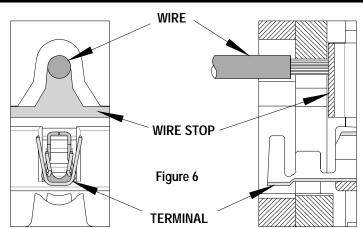


Note:

A crimp height chart is provided with this manual as <u>Reference Only.</u> Due to the wide range of wires, strands, insulation diameters, and durometers available, actual crimp height measurements may very slightly. An occasional, destructive, pull force test should be preformed to check hand tool crimp. Pull Force value <u>Must</u> exceed the Minimum pull force specifications listed.

Locator Installation

See the parts list on the last page of this document for the proper locator order number. Follow the steps below to replace the locator.

- 1. Open the crimp hand tool.
- 2. Squeeze gently on the lower area shown in Figure 7A with your thumb and index finger. The lower tabs of the locator should disengage from the hand tool.

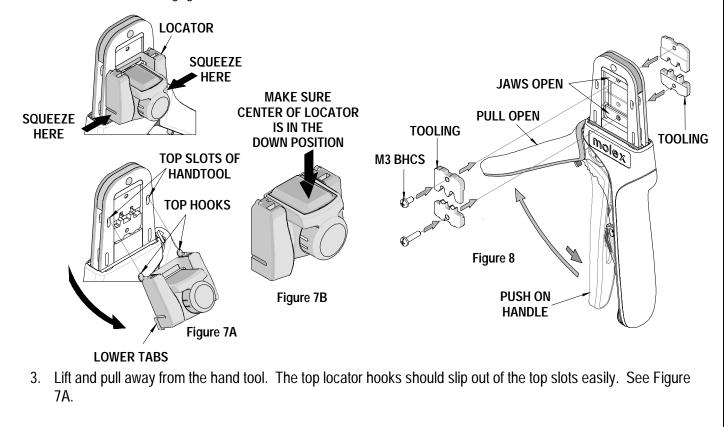

Doc No: ATS-638191100 Revision: A Release Date: 01-09-08 Revision Date: 01-09-08

- 4. To reinstall the new locator, make sure the hand tool is in the open position.
- 5. Press the red insert down as far as it will go as shown in Figure 7B.
- 6. Holding onto the lower part of the locator with your thumb and index finger, insert the locator top hooks (2) into the hand tool top slots.
- 7. Rotate the locator down and press the lower tabs into the two bottom slots of the hand tool. To secure the locator into place, the lower tabs must snap into place on the hand tool frame.

Right or Left Hand Operation


This hand tool has an added feature that can be converted from a right handed application to a left handed application. It is necessary to reverse the tooling along with the locator if using the left handed application. Follow the steps below:


- 1. The locator must be removed before reversing the tooling.
- 2. Remove the M3 BHCS which is holding the upper tooling.
- 3. Flip the upper tooling to the opposite side and replace the M3 BHCS Make sure the small markings on the front and back of the hand tool frame match up and are on the outside of the hand tool frame. See Figure 8 and 9.
- 4. Do the same thing with the lower tooling and tighten the M3 screws. Be sure the small markings line up.
- 5. Reinstall the locator by following the Instructions in the locator replacement section.


Maintenance

It is recommended that each operator of the tool be made aware of, and responsible for, the following maintenance steps:

- 1. Remove dust, moisture, and other contaminants with a clean brush, or soft, lint free cloth.
- 2. Do not use any abrasive materials that could damage the tool.
- 3. Make certain all pins; pivot points and bearing surfaces are protected with a thin coat of high quality machine oil. Do not oil excessively. The tool was engineered for durability but like any other equipment it needs cleaning and lubrication for a maximum service life of trouble free crimping. Light oil (such as 30 weight automotive oil) used at the oil points, every 5,000 crimps or 3 months, will significantly enhance the tool life.
- 4. Wipe excess oil from hand tool, particularly from crimping area. Oil transferred from the crimping area onto certain terminations may affect the electrical characteristics of an application.
- 5. When tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping dies, and store the tool in a clean, dry area.

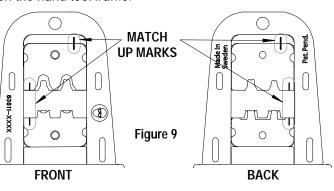

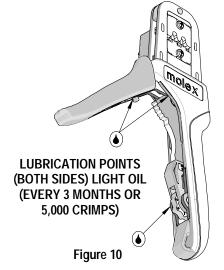

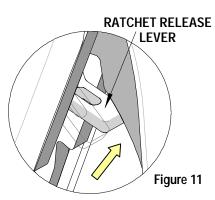

Release Date: 01-09-08 Revision Date: 01-09-08

SOUFEZE HOLD THE HAND Miscrimps or Jams THE LINK IN RATCHET TOOL IN POSITION THE HANDLE RELEASE LEVER Should this tool ever become stuck or jammed in a partially closed position, Do Not force the handles open or closed. The tool will open easily by pressing up on the ratchet release lever in the movable handle. See Figure 11 How to Adjust Tool Preload (See Figure 10) This hand tool is factory preset to 25-45 Figure 12 LBS. preload. It may be necessary over SETTING the life of the tool to adjust tool handle WHEEL preload force. Listed below are the steps

required to adjust the crimping force of the hand tool to obtain proper crimp conditions:

- 1. Hold the hand tool in the palm of your hand as shown in Figure 12. Using the index finger squeeze the link towards the top of the hand tool frame. This will release the preload adjustment wheel.
- 2. Rotate the setting wheel counter-clockwise (CCW) to increase handle force. The numbers will display higher. To decrease handle force, rotate the setting wheel clockwise (CW).
- 3. Release the link to lock the setting wheel in place.
- 4. Check the crimp specifications or conduct a pull test after tool handle preload force is adjusted.

Warranty

This tool is for electrical terminal crimping purposes only. This tool is made of the best quality materials. All vital components are long life tested. All tools are warranted to be free of manufacturing defects for a period of 30 days. Should such a defect occur, we will repair or exchange the tool free of charge. This repair or exchange will not be applicable to altered, misused, or damaged tools. This tool is designed for hand use only. Any clamping, fixturing, or use of handle extensions voids this warranty.

CAUTION: Molex crimp specifications are valid only when used with Molex terminals and tooling.

Release Date: 01-09-08 Revision Date: 01-09-08

CAUTIONS:

- 1. Manually powered hand tools are intended for low volume or field repair. This tool is NOT intended for production use. Repetitive use of this tool should be avoided.
- 2. Insulated rubber handles are not protection against electrical shock.
- 3. Wear eye protection at all times.
- 4. Use only the Molex terminals specified for crimping with this tool.


Certification

Molex does not certify or re-certify hand tools but rather supplies the following guidelines for customers to re-certify hand tools.

- This tool is qualified to pull force only. To re-certify, crimp a terminal to a wire, which has been stripped 12.7mm (1/2") long, so there is no crimping of the insulation. Pull the terminal and wire at a rate no faster than 25mm (1.00") per minute. See the Molex web site for the Quality Crimp Handbook for more information on pull testing.
- If the tool does not meet minimum pull force values, handle preload should be increased and the pull test rerun, (See How to Adjust Preload).
- When the hand tool is no longer capable of achieving minimum pull force, it should be taken out of service and replaced.

PARTS LIST

Item Number	Order Number	Description	Quantity
REF	63819-1100	Hand Crimp Tool	Figure 13
1	63819-1175	Locator Assembly (Red)	1
1	63819-1176	Locator Assembly (Yellow)	1
1	63819-1177	Locator Assembly (Gray)	1
2	63810-0104	Spring, Return	1
3	63810-0105	Spring, Ratchet	1

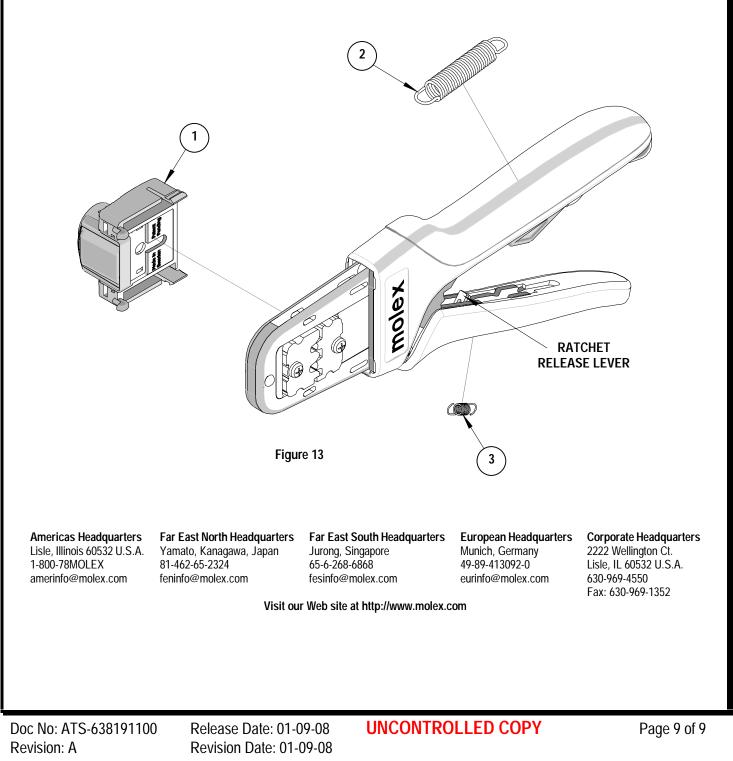

Downloaded from **Elcodis.com** electronic components distributor