



1	2	3	4
Description	Material	Finish	
Nut	Brass	Nickel	
Washer	Brass	Nickel	
Main Body	Brass	Nickel	
Pin Insulator	Teflon	Teflon	
Socket	BE CU	Gold	
Spacer	Teflon	Teflon	
Shield Sleeve	Brass	Nickel	
Retaining Nut	Brass	Nickel	
Crimp Ring	Brass	Nickel	


RECOMMENDED CABLE STRIPPING DIMENSIONS

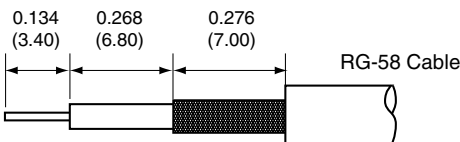


RECOMMENDED MOUNTING HOLE

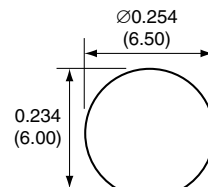


SIDE VIEW

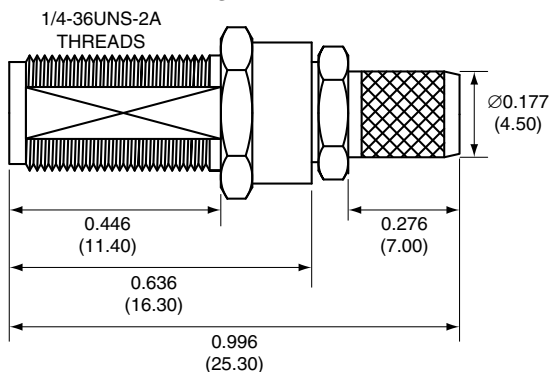


SOCKET

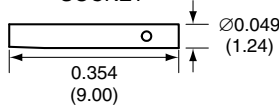


WASHER

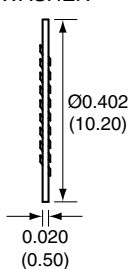


NUT

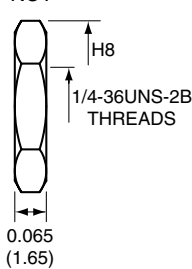

CRIMP RING

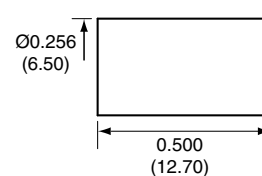

CONREVSMA005-R58 ASSEMBLY INSTRUCTIONS

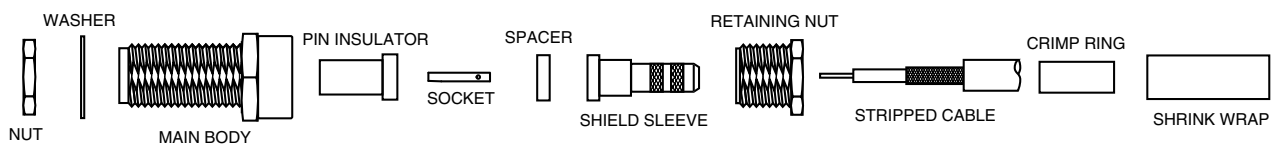

1. Insert the center conductor through the retaining nut, shield sleeve, and spacer.
2. Solder the pin to the center conductor.
3. Insert the pin into the pin insulator, then screw the main body onto the retaining nut.
4. Wrap the braid around the tail of the body and crimp the ring with a hex crimp tool.
5. Use the shrink wrap to cover the crimp ring.
6. Use the nut and washer to secure the connector to a case.

Title SMA FEMALE BULKHEAD MOUNT CABLE END CRIMP FOR RG58 CABLE		CONNECTOR CITY 159 ORT LANE MERLIN, OR 97532	
Part No. CONSMA005-R58	Revision: 1.0	PH (541)-471-6256 FAX (541)-471-6251	
Dimensions: INCHES (mm)	Date: 5/29/2007	Sheet 1 of 1	

**CONNECTOR CITY**  
THE VALUE OF CONNECTIONS