

Watthour and Varhour Meters With pulse initiator Solid-state type

Watthour and varhour meters with pulse initiator

■ Description

These watthour and varhour meters are small in size –72mm wide, 144mm high and 99.5mm deep.

They have easy to read display and operation status indicator using a solid-state circuit.

■ Features

Very compact

- Thin type of 89mm deep (without the front panel)

Easy-to-read display

- Watthour/varhour count shown in large LCD figures
- Operation status indicators for counting, stop, reverse current, and operating

- Bar-type load indicator

Wide variety of output pulses

- Four types of signal outputs available
- One of four output pulse multiplying factors can be selected.
- The meter front has an output pulse terminal for calibration.

Easy parameter setting

- Preset operation can be displayed on the LCD for checking.
- Parameters can be preset even when power to the meter is off.
- Parameters can be preset for all combined transformation ratios.



F3C-S22VR

■ Ordering information

Specify the following:

- Type number or ordering code
- Rated voltage, max. current and frequency
- VT and CT ratio

■ Specifications

Type	Normal watthour meter				Precision watthour meter		Varhour meter								
	F1C-S22VR	F2C-S22VR	F3C-S22VR	F4A-S22VR	FP3C-S22VR	FP4C-S22VR	FV3C-S22VR	FV4A-S22VR							
Phase and wiring	1φ2W	1φ3W	3φ3W	3φ4W	3φ3W	3φ4W	3φ3W	3φ4W							
Mounting	Flush mounting rear connection														
Rated voltage (V) <i>Replace the ■ mark in the ordering code by voltage code.</i>	■ □/110: 1 100: 2 200: 3 240: 5	100	■ □/110: 1 200: 3	■ □/63.5: 1 □/110: 2 100: 3 240: 5	110	■ □/63.5: 1 □/110: 2 240: 5	110	■ □/63.5: 1 □/110: 2 240: 5							
Rated current (A)	□/5	□/5 or □/1													
Rated frequency (Hz)	50 or 60														
Multiplying factor	Integral power of 10 composite transformation ratio or 1/10 of composite transformation ratio														
Indication	Measured value Operation Measuring state Operating state														
Burden	Voltage circuit	P ₁ -P ₂ : 1.0VA Other : 0.1VA	P ₁ -P ₀ : 3.0VA Other : 0.1VA	P ₁ -P ₂ : 1.0VA Other : 0.1VA	P ₁ -P ₀ : 10VA Other : 0.1VA										
	Current circuit	Each phase : 0.1VA													
Dimensions (mm)	72(W) × 144(H) × 99.5(D)														
Mass (g)	850	870	850	870	850	870									

Note: □ : VT primary voltage or CT primary current


■ Pulse output

Type	Output	Contact capacity	Pulse width	Pulse factor	Output pulse unit
Output pulse 1	Non-voltage 1NO contact	125V AC 0.1A or less 125V DC 0.1A or less	200 ±50ms	Inherent pulse, or 10 ⁿ pulse	Composite transformation ratio Inherent pulse constant
Output pulse 2	Open collector (Transistor)	35V DC 50mA or less	200 ±50ms or 1050 ±50ms	10 ⁿ pulse	
Output pulse 3	Open collector (Transistor)	35V DC 50mA or less	15 ±2ms	Inherent pulse	Composite transformation ratio Inherent pulse constant
For test	Open collector (Transistor)	35V DC 50mA or less	32μs	Just same as the factor of the meters	Composite transformation ratio Inherent pulse constant ×3600


Notes: 10ⁿ of output 1 and pulse width of output pulse 2 are changed to 30 ±10ms by setting contents of composite transformation ratio and output pulse unit.

Watthour and Varhour Meters
With pulse initiator
Solid-state type

■ Dimensions, mm

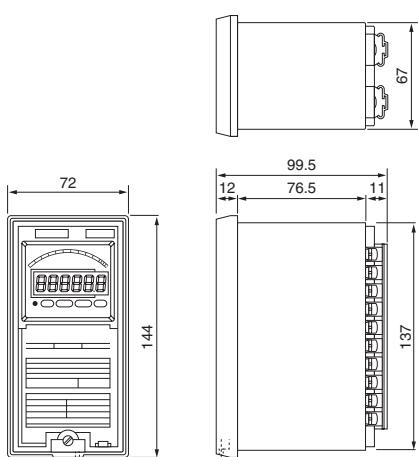


■ Mounting

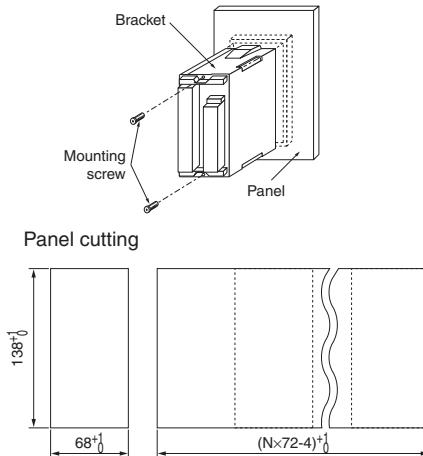


■ Wiring diagrams

● VT/CT operated meters


1φ 2W

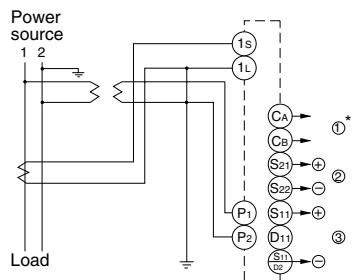

1φ 3W / 3φ 3W

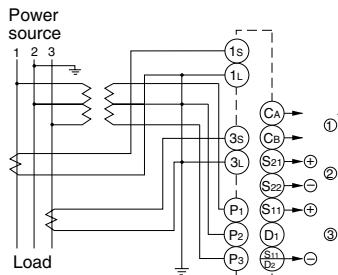


3φ 4W

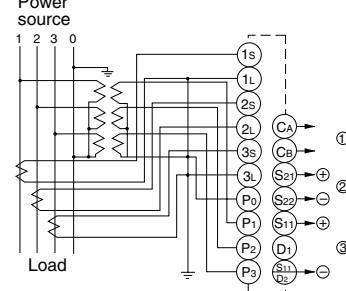


● CT operated meters


1φ 2W

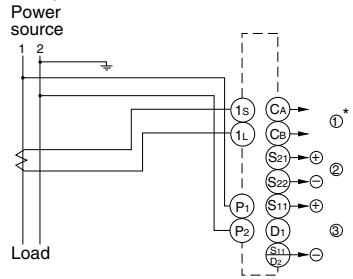

1φ 3W / 3φ 3W

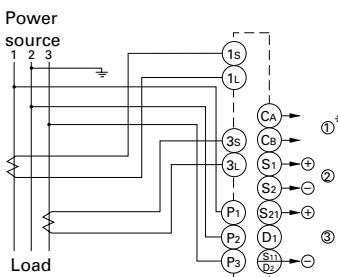

3φ 4W

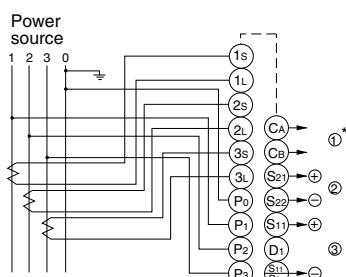

Notes: * ① Non-voltage "NO" contact output

② Open collector output: Integral power of 10 (primary conversion)

③ Open collector output: Inherent (secondary conversion)

■ Circuits of pulse output initiating unit

