SONY

ICX429ALB

Diagonal 8mm (Type 1/2) CCD Image Sensor for CCIR B/W Video Cameras

Description

The ICX429ALB is an interline CCD solid-state image sensor suitable for CCIR B/W video cameras with a diagonal 8mm (Type 1/2) system. Basic characteristics such as sensitivity, smear, dynamic range and S/N are improved drastically through the adoption of EXview HAD CCDTM technology.

This chip features a field period readout system and an electronic shutter with variable charge-storage time. Also, this outline is miniaturized by using original package. This chip is compatible with the pins of the ICX249ALB and has the same drive conditions.

EXview HAD CCD[™] has differrent spectral characteristics from the curreent CCD.

Features

- High sensitivity
- Low smear
- High D range (+1dB compared with the ICX249AL)
- High S/N
- High resolution and low dark current
- Excellent antiblooming characteristics
- Continuous variable-speed shutter
- Substrate bias: Adjustment free (external adjustment also possible with 6 to 14V)
- Reset gate pulse: 5Vp-p adjustment free (drive also possible with 0 to 9V)
- Horizontal register: 5V drive
- Maximum package dimensions:
 ϕ 13.2mm

Device Structure

- Interline CCD image sensor
- Optical size:
 - size: Diagonal 8mm (Type 1/2)
- Number of effective pixels: 752 (H) \times 582 (V) approx. 440K pixels
- Total number of pixels: 795 (H) \times 596 (V) approx. 470K pixels
- Chip size: 7.40mm (H) × 5.95mm (V)
- Unit cell size: 8.6µm (H) \times 8.3µm (V)
- Optical black: Horizontal (H) direction: Front 3 pixels, rear 40 pixels
 - Vertical (V) direction: Front 12 pixels, rear 2 pixels
- Number of dummy bits: Horizontal 22
 - Vertical 1 (even fields only)


Silicon


Substrate material:

EXview HAD CCD

- * EXview HAD CCD is a trademark of Sony Corporation.
- EXview HAD CCD is a CCD that drastically improves light efficiency by including near infrared light
 - Sony reserves the right to change products and specifications without prior notice. This information does not convey any license by any implication or otherwise under any patents or other right. Application circuits shown, if any, are typical examples illustrating the operation of the devices. Sony cannot assume responsibility for any problems arising out of the use of these circuits.



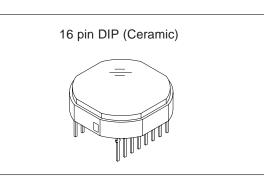

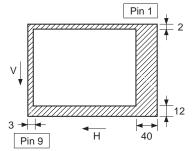

Optical black position (Top View)

3 → ↓ ← Pin 9 Optical bla

USE RESTRICTION NOTICE (December 1, 2003 ver.)

This USE RESTRICTION NOTICE ("Notice") is for customers who are considering or currently using the CCD products ("Products") set forth in this specifications book. Sony Corporation ("Sony") may, at any time, modify this Notice which will be available to you in the latest specifications book for the Products. You should abide by the latest version of this Notice. If a Sony subsidiary or distributor has its own use restriction notice on the Products, such a use restriction notice will additionally apply between you and the subsidiary or distributor. You should consult a sales representative of the subsidiary or distributor of Sony on such a use restriction notice when you consider using the Products.

Use Restrictions

- The Products are intended for incorporation into such general electronic equipment as office products, communication products, measurement products, and home electronics products in accordance with the terms and conditions set forth in this specifications book and otherwise notified by Sony from time to time.
- You should not use the Products for critical applications which may pose a life- or injury- threatening risk or are highly likely to cause significant property damage in the event of failure of the Products. You should consult your Sony sales representative beforehand when you consider using the Products for such critical applications. In addition, you should not use the Products in weapon or military equipment.
- Sony disclaims and does not assume any liability and damages arising out of misuse, improper use, modification, use of the Products for the above-mentioned critical applications, weapon and military equipment, or any deviation from the requirements set forth in this specifications book.

Design for Safety

• Sony is making continuous efforts to further improve the quality and reliability of the Products; however, failure of a certain percentage of the Products is inevitable. Therefore, you should take sufficient care to ensure the safe design of your products such as component redundancy, anti-conflagration features, and features to prevent mis-operation in order to avoid accidents resulting in injury or death, fire or other social damage as a result of such failure.

Export Control

• If the Products are controlled items under the export control laws or regulations of various countries, approval may be required for the export of the Products under the said laws or regulations. You should be responsible for compliance with the said laws or regulations.

No License Implied

The technical information shown in this specifications book is for your reference purposes only. The
availability of this specifications book shall not be construed as giving any indication that Sony and its
licensors will license any intellectual property rights in such information by any implication or otherwise. Sony
will not assume responsibility for any problems in connection with your use of such information or for any
infringement of third-party rights due to the same. It is therefore your sole legal and financial responsibility to
resolve any such problems and infringement.

Governing Law


• This Notice shall be governed by and construed in accordance with the laws of Japan, without reference to principles of conflict of laws or choice of laws. All controversies and disputes arising out of or relating to this Notice shall be submitted to the exclusive jurisdiction of the Tokyo District Court in Japan as the court of first instance.

Other Applicable Terms and Conditions

• The terms and conditions in the Sony additional specifications, which will be made available to you when you order the Products, shall also be applicable to your use of the Products as well as to this specifications book. You should review those terms and conditions when you consider purchasing and/or using the Products.

Block Diagram and Pin Configuration

(Top View)

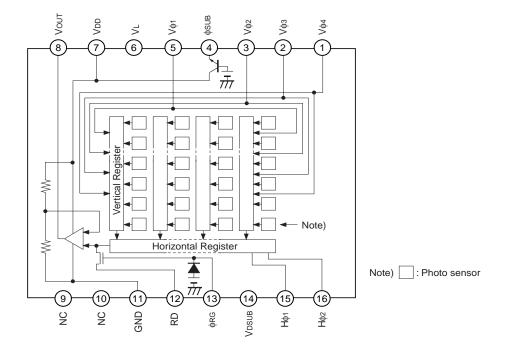

Pin Description

Pin No.	Symbol	Description	Pin No.	Symbol	Description
1	Vφ4	Vertical register transfer clock	9	NC	
2	Vфз	Vertical register transfer clock	10	NC	
3	Vø2	Vertical register transfer clock	11	GND	GND
4	фѕив	Substrate clock	12	RD	Reset drain bias
5	Vφ1	Vertical register transfer clock	13	¢ RG	Reset gate clock
6	VL	Protective transistor bias	14	Vdsub	Substrate bias circuit supply voltage
7	Vdd	Output circuit supply voltage	15	Ηφ1	Horizontal register transfer clock
8	Vout	Signal output	16	Hø2	Horizontal register transfer clock

Absolute Maximum Ratings

	Item	Ratings	Unit	Remarks
Substrate clock	в – GND	-0.3 to +50	V	
Supply voltage	Vdd, Vrd, Vdsub, Vout – GND	-0.3 to +18	V	
Supply voltage	Vdd, Vrd, Vdsub, Vout – φsub	-55 to +10	V	
	Vφ1, Vφ2, Vφ3, Vφ4 – GND	-15 to +20	V	
Clock input voltage	Vφ1, Vφ2, Vφ3, Vφ4 – φsub	to +10	V	
Voltage difference b	etween vertical clock input pins	to +15	V	*1
Voltage difference b	etween horizontal clock input pins	to +17	V	
Ηφ1, Ηφ2 – Vφ4		-17 to +17	V	
φrg – GND		-10 to +15	V	
φrg — φsub		-55 to +10	V	
VL – ¢SUB		-65 to +0.3	V	
Pins other than GN	D and фsuв – VL	-0.3 to +30	V	
Storage temperature	e	-30 to +80	°C	
Operating temperate	ure	-10 to +60	°C	

 *1 +27V (Max.) when clock width < 10 $\mu s,$ clock duty factor < 0.1%.

Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Output circuit supply voltage	Vdd	14.55	15.0	15.45	V	
Reset drain voltage	Vrd	14.55	15.0	15.45	V	Vrd = Vdd
Protective transistor bias	VL		*1			
Substrate bias circuit supply voltage	Vdsub	14.55	15.0	15.45	V	
Substrate clock	фѕив		*2			

Bias Conditions 1 [when used in substrate bias internal generation mode]

*1 VL setting is the V∨L voltage of the vertical transfer clock waveform, or the same supply voltage as the VL power supply for the V driver should be used. (When CXD1267AN is used.)

*2 Do not apply a DC bias to the substrate clock pin, because a DC bias is generated within the CCD.

Bias Conditions 2 [when used in substrate bias external adjustment mode]

Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Output circuit supply voltage	Vdd	14.55	15.0	15.45	V	
Reset drain voltage	Vrd	14.55	15.0	15.45	V	Vrd = Vdd
Protective transistor bias	VL		*3			
Substrate bias circuit supply voltage	Vdsub		*4			
Substrate voltage adjustment range	Vsuв	6.0		14.0	V	*5
Substrate voltage adjustment precision	ΔVsub	-3		+3	%	*5

*3 VL setting is the VvL voltage of the vertical transfer clock waveform, or the same supply voltage as the VL power supply for the V driver should be used. (When CXD1267AN is used.)

*4 Connect to GND or leave open.

*5 The setting value of the substrate voltage (Vsub) is indicated on the back of the image sensor by a special code. When adjusting the substrate voltage externally, adjust the substrate voltage to the indicated voltage. The adjustment precision is ±3%. However, this setting value has not significance when used in substrate bias internal generation mode.

VSUB code — one character indication

Code and optimal setting correspond to each other as follows.

Vsub code	Е	f	G	h	J	К	L	m	Ν	Р	Q	R	S	Т	U	V	W
Optimal setting	6.0	6.5	7.0	7.5	8.0	8.5	9.0	9.5	10.0	10.5	11.0	11.5	12.0	12.5	13.0	13.5	14.0

<Example> "L" \rightarrow Vsub = 9.0V

DC Characteristics

Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Output circuit supply current	ldd		5.0	10.0	mA	

Clock Voltage Conditions


Item	Symbol	Min.	Тур.	Max.	Unit	Waveform diagram	Remarks
Readout clock voltage	Vvт	14.55	15.0	15.45	V	1	
	Vvh1, Vvh2	-0.05	0	0.05	V	2	Vvн = (Vvн1 + Vvн2)/2
	Vvнз, Vvн4	-0.2	0	0.05	V	2	
	Vvl1, Vvl2, Vvl3, Vvl4	-9.6	-9.0	-8.5	V	2	$V_{VL} = (V_{VL3} + V_{VL4})/2$
	Vov	8.3	9.0	9.65	Vp-p	2	$V\phi v = VvHn - VvLn (n = 1 to 4)$
Vertical transfer clock	Vvh1 – Vvh2			0.1	V	2	
voltage	Vvнз — Vvн	-0.25		0.1	V	2	
	Vvh4 – Vvh	-0.25		0.1	V	2	
	V∨нн			0.5	V	2	High-level coupling
	Vvhl			0.5	V	2	High-level coupling
	Vvlh			0.5	V	2	Low-level coupling
	Vvll			0.5	V	2	Low-level coupling
Horizontal transfer	Vфн	4.75	5.0	5.25	Vp-p	3	
clock voltage	Vhl	-0.05	0	0.05	V	3	
_	Vrgl		*1		V	4	
Reset gate clock voltage ^{*1}	Vørg	4.5	5.0	5.5	Vp-p	4	
	Vrglh – Vrgll			0.8	V	4	Low-level coupling
Substrate clock voltage	Vфsuв	23.0	24.0	25.0	Vp-p	5	

*1 Input the reset gate clock without applying a DC bias. In addition, the reset gate clock can also be driven with the following specifications.


Item	Symbol	Min.	Тур.	Max.	Unit	Waveform diagram	Remarks
Reset gate clock	Vrgl	-0.2	0	0.2	V	4	
voltage	Vørg	8.5	9.0	9.5	Vp-p	4	

Clock Equivalent Circuit Constant

Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Capacitance between vertical transfer clock	Cφν1, Cφν3		3300		pF	
and GND	Cφν2, Cφν4		3300		pF	
Capacitance between vertical transfer clocks	Сфv12, Сфv34		820		pF	
	Сфv23, Сфv41		330		pF	
Capacitance between horizontal transfer clock	Сфн1		120		pF	
and GND	Сфн2		91		pF	
Capacitance between horizontal transfer clocks	Сфнн		47		pF	
Capacitance between reset gate clock and GND	Cørg		11		pF	
Capacitance between substrate clock and GND	Сфѕив		680		pF	
	R1, R3		75		Ω	
Vertical transfer clock series resistor	R2, R4		82		Ω	
Vertical transfer clock ground resistor	Rgnd		68		Ω	

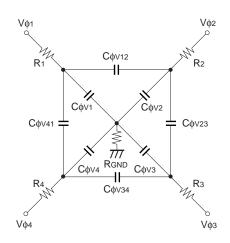


Vertical transfer clock equivalent circuit




Horizontal transfer clock equivalent circuit

Drive Clock Waveform Conditions

(1) Readout clock waveform

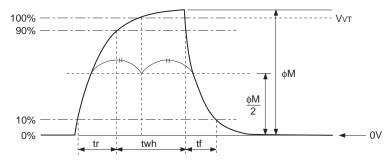




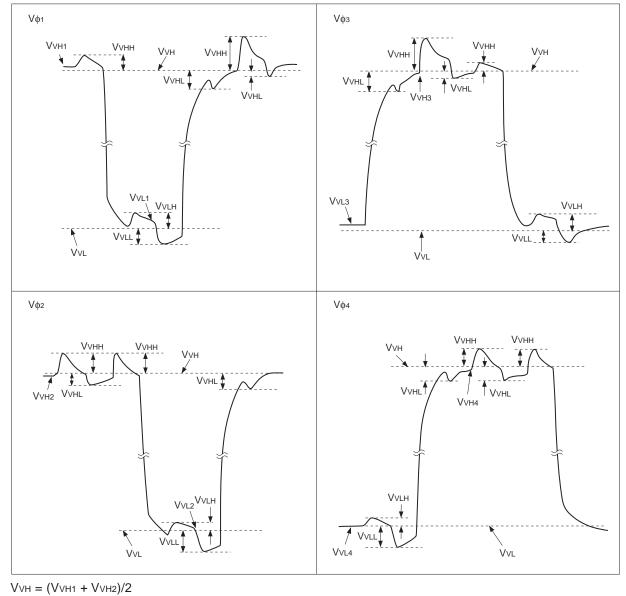

 $V_{VL} = (V_{VL3} + V_{VL4})/2$

 $V\phi = V + n - V + n (n = 1 \text{ to } 4)$

(3) Horizontal transfer clock waveform

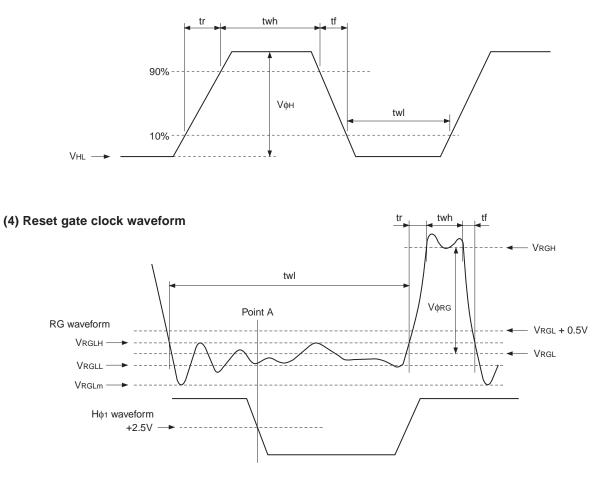

 V_{RGLH} is the maximum value and V_{RGLL} is the minimum value of the coupling waveform during the period from Point A in the above diagram until the rising edge of RG. In addition, V_{RGL} is the average value of V_{RGLH} and V_{RGLL} .


VRGL = (VRGLH + VRGLL)/2

Assuming VRGH is the minimum value during the period twh, then:

 $V\phi RG = VRGH - VRGL$

Negative overshoot level during the falling edge of RG is VRGLm.

(5) Substrate clock waveform

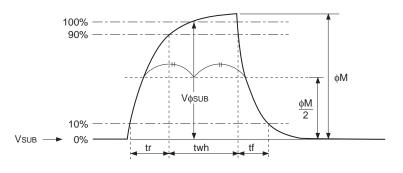

Clock Switching Characteristics

	Item	Symbol		twh			twl			tr			tf		Unit	Remarks
	nem	Symbol	Min.	Тур.	Max.	Unit	Remarks									
Rea	adout clock	Vτ	2.3	2.5					0.5			0.5			μs	During readout
Ver cloc	tical transfer ck	Vφ1, Vφ2, Vφ3, Vφ4										15		250	ns	*1
Horizontal transfer clock	During imaging	Hφ		20			20			15	19		15	19	ns	*2
rizon 1sfer	During	Ηφ1		5.38						0.01			0.01			
Ho trai	parallel-serial conversion	Ηφ2					5.38			0.01			0.01		μs	
Res	set gate clock	φRG	11	13			51			3			3		ns	
Sub	ostrate clock	φSUB	1.5	1.8							0.5			0.5	μs	When draining charge

 $^{\rm *1}$ When vertical transfer clock driver CXD1267AN is used.

*2 tf \geq tr - 2ns.

ltom	Symbol		two		ا لما ا	Domorko	
Item	Symbol	Min.	Тур.	Max.	Unit	Remarks	
Horizontal transfer clock	Ηφ1, Ηφ2	16	20		ns	*3	

*3 The overlap period for twh and twl of horizontal transfer clocks H ϕ_1 and H ϕ_2 is two.

(Ta = 25°C)

Image Sensor Characteristics

Item	Symbol	Min.	Тур.	Max.	Unit	Measurement method	Remarks
Sensitivity1	S1	1120	1400		mV	1	
Sensitivity2	S2	4500	5500		mV	2	
Saturation signal	Vsat	1000			mV	3	Ta = 60°C
Smear	Sm		-126	-115	dB	4	
	SH			20	%	5	Zone 0 and I
Video signal shading	50			25	%	5	Zone 0 to II'
Dark signal	Vdt			2	mV	6	Ta = 60°C
Dark signal shading	∆Vdt			1	mV	7	Ta = 60°C
Flicker	F			2	%	8	
Lag	Lag			0.5	%	9	

Zone Definition of Video Signal Shading

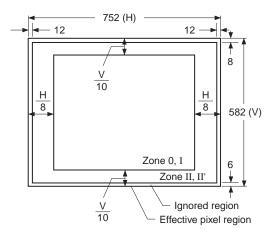


Image Sensor Characteristics Measurement Method

O Measurement conditions

- In the following measurements, the device drive conditions are at the typical values of the bias and clock voltage conditions. (when used with substrate bias external adjustment, set the substrate voltage to the value indicated on the device.)
- 2) In the following measurements, spot blemishes are excluded and, unless otherwise specified, the optical black level (OB) is used as the reference for the signal output, which is taken as the value of Y signal output or chroma signal output of the measurement system.

◎ Definition of standard imaging conditions

1) Standard imaging condition I:

Use a pattern box (luminance 706cd/m², color temperature of 3200K halogen source) as a subject. (Pattern for evaluation is not applicable.) Use a testing standard lens with CM500S (t = 1.4mm) as an IR cut filter and image at F8. The luminous intensity to the sensor receiving surface at this point is defined as the standard sensitivity testing luminous intensity.

2) Standard imaging condition II:

This indicates the standard imaging condition I with the IR cut filter removed.

3) Standard imaging condition III:

Image a light source (color temperature of 3200K) with a uniformity of brightness within 2% at all angles. Use a testing standard lens and the luminous intensity is adjusted to the value indicated in each testing item by the lens diaphragm. (IR cut filter is not spplicable.)

1. Sensitivity1

Set to standard imaging condition I. After selecting the electronic shutter mode with a shutter speed of 1/250s, measure the signal output (Vs1) at the center of the screen and substitute the value into the following formula.

$$S1 = V_{S1} \times \frac{250}{50} [mV]$$

2. Sensitivity2

Set to standard imaging condition II. After selecting the electronic shutter mode with a shutter speed of 1/1000s, measure the signal output (Vs₂) at the center of the screen and substitute the value into the following formula.

$$S2 = Vs_2 \times \frac{1000}{50} [mV]$$

3. Saturation signal

Set to standard imaging condition III. After adjusting the luminous intensity to 10 times the intensity with average value of the signal output, 200mV, measure the minimum value of the signal output.

4. Smear

Set to standard imaging condition III. With the lens diaphragm at F5.6 to F8, adjust the luminous intensity to 500 times the intensity with average value of the signal output, 200mV. When the readout clock is stopped and the charge drain is executed by the electronic shutter at the respective H blankings, measure the maximum value VSm [mV] of the signal output and substitute the value into the following formula.

Sm =
$$20 \times \log \left(\frac{VSm}{200} \times \frac{1}{500} \times \frac{1}{10} \right)$$
 [dB] (1/10V method conversion value)

5. Video signal shading

Set to standard imaging condition III. With the lens diaphragm at F5.6 to F8, adjust the luminous intensity so that the average value of the signal output is 200mV. Then measure the maximum (Vmax [mV]) and minimum (Vmin [mV]) values of the signal output and substitute the values into the following formula.

SH = (Vmax - Vmin)/200 × 100 [%]

6. Dark signal

Measure the average value of the signal output (Vdt [mV]) with the device ambient temperature 60°C and the device in the light-obstructed state, using the horizontal idle transfer level as a reference.

7. Dark signal shading

After measuring 6, measure the maximum (Vdmax [mV]) and minimum (Vdmin [mV]) values of the dark signal output and substitute the values into the following formula.

 $\Delta V dt = V dmax - V dmin [mV]$


8. Flicker


Set to standard imaging condition III. Adjust the luminous intensity so that the average value of the signal output is 200mV, and then measure the difference in the signal level between fields ($\Delta Vf [mV]$). Then substitute the value into the following formula.

 $Fy = (\Delta V f/200) \times 100 [\%]$

9. Lag


Adjust the signal output value generated by strobe light to 200mV. After setting the strobe light so that it strobes with the following timing, measure the residual signal (Vlag). Substitute the value into the following formula.

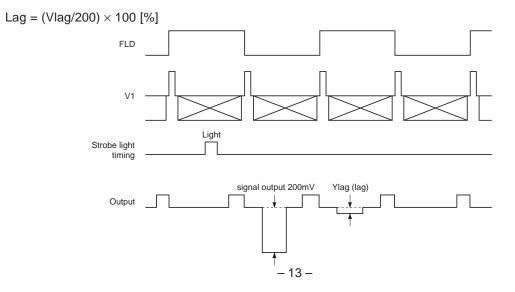

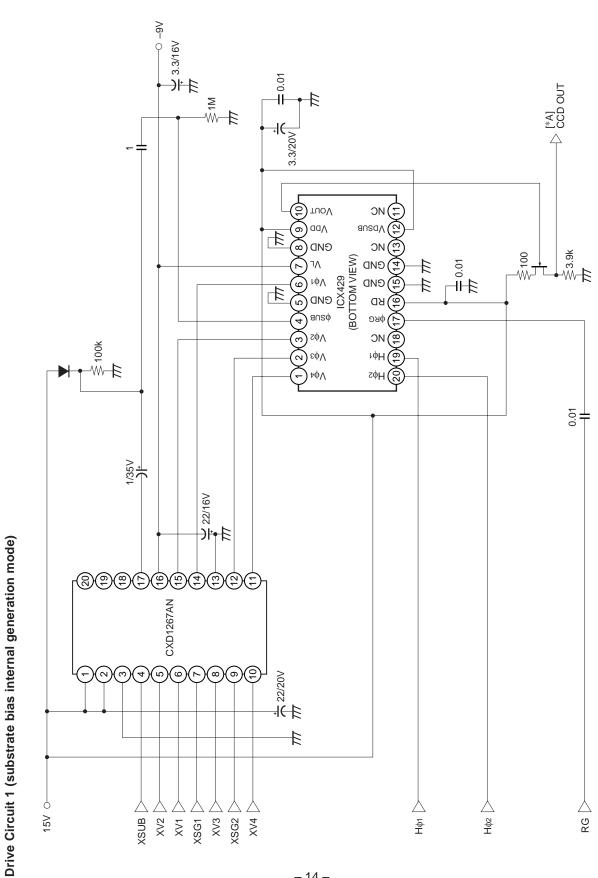


- 14 -




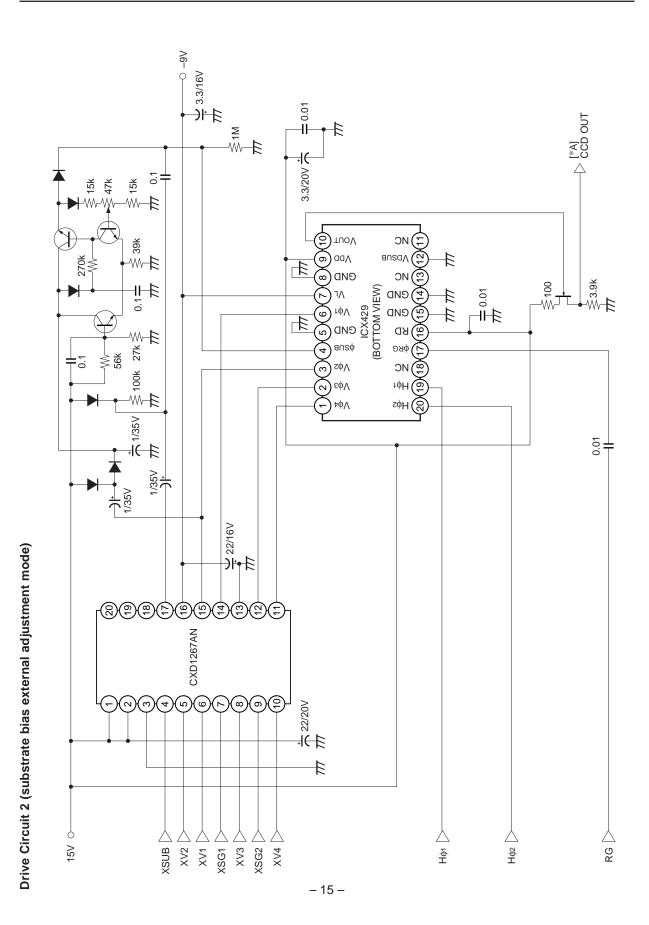


Spectral Sensitivity Characteristics (Excludes lens characteristics and light source characteristics)

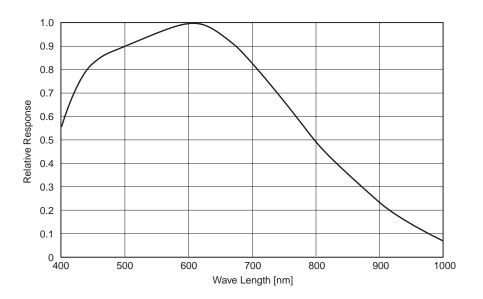

Sensor Readout Clock Timing Chart

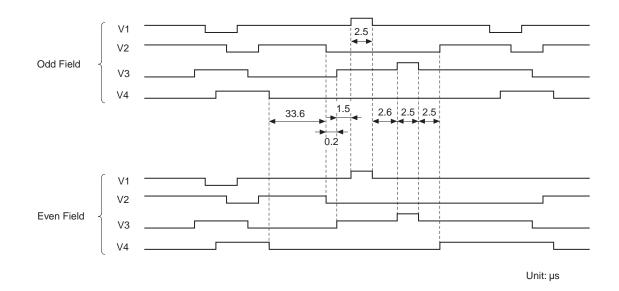

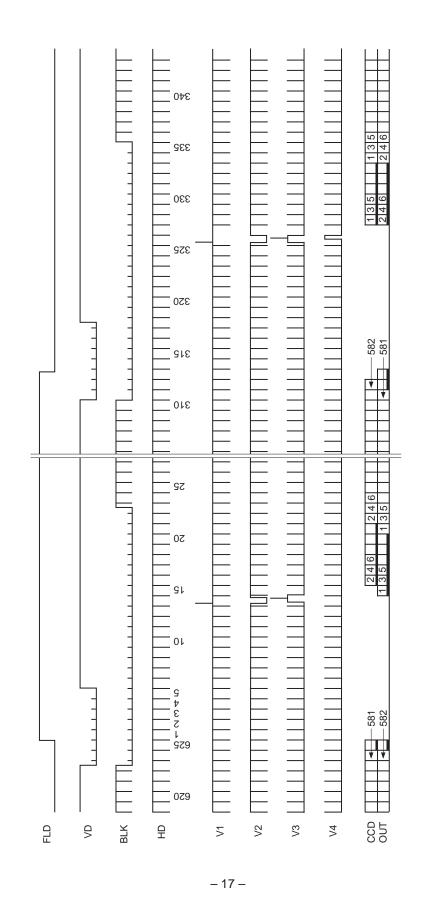

Drive Timing Chart (Vertical Sync)



4

V V3

SUB

Notes on Handling

1) Static charge prevention

CCD image sensors are easily damaged by static discharge. Before handling be sure to take the following protective measures.


- a) Either handle bare handed or use non-chargeable gloves, clothes or material. Also use conductive shoes.
- b) When handling directly use an earth band.
- c) Install a conductive mat on the floor or working table to prevent the generation of static electricity.
- d) Ionized air is recommended for discharge when handling CCD image sensor.
- e) For the shipment of mounted substrates, use boxes treated for the prevention of static charges.

2) Soldering

- a) Make sure the package temperature does not exceed 80°C.
- b) Solder dipping in a mounting furnace causes damage to the glass and other defects. Use a ground 30W soldering iron and solder each pin in less than 2 seconds. For repairs and remount, cool sufficiently.
- c) To dismount an image sensor, do not use a solder suction equipment. When using an electric desoldering tool, use a thermal controller of the zero cross On/Off type and connect it to ground.
- 3) Dust and dirt protection

Image sensors are packed and delivered by taking care of protecting its glass plates from harmful dust and dirt. Clean glass plates with the following operations as required, and use them.

- a) Perform all assembly operations in a clean room (class 1000 or less).
- b) Do not either touch glass plates by hand or have any object come in contact with glass surfaces. Should dirt stick to a glass surface, blow it off with an air blower. (For dirt stuck through static electricity ionized air is recommended.)
- c) Clean with a cotton bud and ethyl alcohol if grease stained. Be careful not to scratch the glass.
- d) Keep in a case to protect from dust and dirt. To prevent dew condensation, preheat or precool when moving to a room with great temperature differences.
- e) When a protective tape is applied before shipping, just before use remove the tape applied for electrostatic protection. Do not reuse the tape.
- 4) Do not expose to strong light (sun rays) for long periods. For continuous using under cruel condition exceeding the normal using condition, consult our company.
- 5) Exposure to high temperature or humidity will affect the characteristics. Accordingly avoid storage or usage in such conditions.
- 6) CCD image sensors are precise optical equipment that should not be subject to too much mechanical shocks.

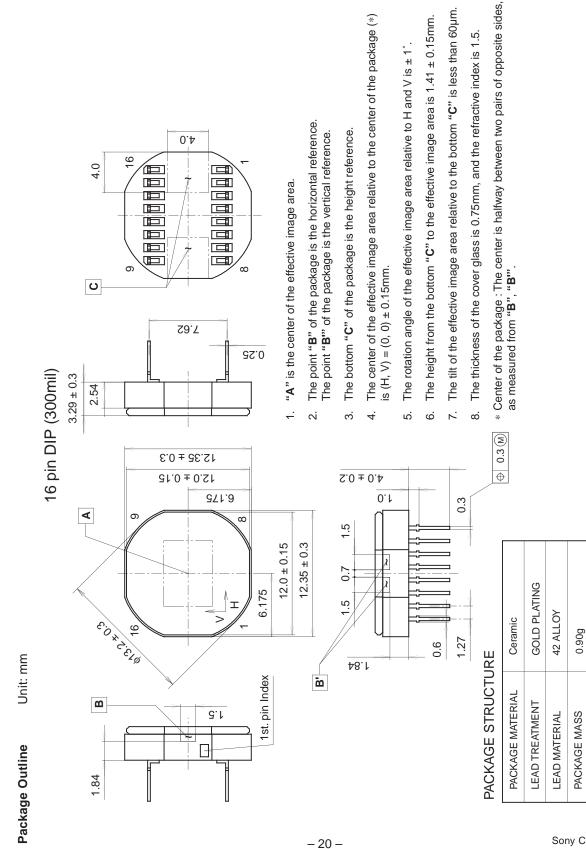

Sony Corporation

DRAWING NUMBER

AS-B4-01(E)