


# Models 7063 TNC (F) 50 Ω Bulkhead, Crimp RG-55, 142, 223, 400



Model 7063 TNC (F ) 50  $\Omega$  Bulkhead Crimp RG-55, 142, 223, 400

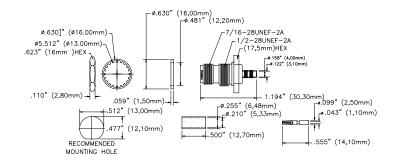

See page 2 for cable type, crimp information and cable assembly instructions.

# Use for your 50 $\Omega$ TNC panel mount cable assembly applications.

#### Features

- Designed for common cables (see table on page 2 for cable types and crimp die information).
- Precision machined.
- Gold-plated (15 micro-inches) contacts.
- Insulation material is PTFE (not delrin).

#### **Materials**

- Body is machined brass with tarnish resistant nickel plating.
- Female center contacts are gold plated (15 micro-inches) beryllium copper.
- High quality machined PTFE dielectric.

### **Ordering Information**

Model: 7063, TNC (F) Bulkhead, 50  $\Omega$ .

## Specifications

Nominal impedance	50 Ω	
Frequency	0-11 GHz	
VSWR	1.30 max. 011 GHz	
Center / Outer contact resistance	1.5 / 0.2 mΩ	
Number of insertions	500	
Insulation resistance	5000 MΩ (min)	
Dielectric withstand voltage	1500 Vrms	
Ratings: Voltage: 500 Vrms Operating temperature: -85 °F to +131 °F (-65 °C to +155 °C) Max.		

 USA:
 Sales:
 800-490-2361
 Technical Support:
 800-241 

 2060
 Fax:
 888-403-3360
 International:
 425-446-5500

 e-mail:
 technicalsupport@pomonatest.com
 International:
 425-446-5500

Where to Buy: www.pomonaelectronics.com

All dimensions are in inches. Tolerances (except noted):  $.xx = \pm .02^{\circ}$  (,51 mm),  $.xxx = \pm .005^{\circ}$  (,127 mm). All specifications are to the latest revisions. Specifications are subject to change without notice. Registered trademarks are the property of their respective companies.

Copyright © 2004 10/2004 2401529 D-ENG-N Rev A Page 1 of 2



## Models 7063 TNC (F) 50 Ω Bulkhead, Crimp RG-55, 142, 223, 400

#### **Cable Type and Crimp Die Sizes**

Connector Model #	Cable Groups	Crimp Die set* Size (Hex/Pin)
7063	RG-55, 142, 223, 400	Model 7278 (.213/ .068)

\*For use with Pomona crimp tool Model 7277.

#### **Cable Assembly Instructions**


1. CUT CABLE END EVENLY AND PERPENDICULAR



2. SLIDE OUTER FERRULE OVER CABLE END.



 STRIP CABLE JACKET, BRAID, AND DIELECTRIC TO SPECIFICATION LENGTHS. (NOTE: FOIL AND BRAID CABLES SHOULD LEAVE FOIL TO END OF DIELECTRIC).




RECOMMENDED STRIP LENGTHS FOR MODEL 7063


 INSERT CONTACT PIN ONTO CABLE'S CENTER CONDUCTOR SO THAT IT IS FLUSH TO DIELECTRIC, CRIMP OR SOLDER CONTACT FIRMLY.




5. FLARE BRAID END SLIGHTLY.




6. INSERT PIN-END INTO CONNECTOR BODY AND PUSH UNTIL IT CLICKS INTO PLACE.



7. SLIDE OUTER FERRULE OVER BRAID AND UP AGAINST BODY ASSEMBLY.



8. CRIMP OUTER FERRULE WITH APPROPRIATE CRIMP TOOL.



 USA:
 Sales: 800-490-2361
 Technical Support: 800-241 

 2060
 Fax: 888-403-3360
 International: 425-446-5500

 e-mail:
 technicalsupport@pomonatest.com

Where to Buy: www.pomonaelectronics.com

All dimensions are in inches. Tolerances (except noted):  $.xx = \pm .02^{\circ}$  (,51 mm),  $.xxx = \pm .005^{\circ}$  (,127 mm). All specifications are to the latest revisions. Specifications are subject to change without notice. Registered trademarks are the property of their respective companies.