Advance Information

MPC755BLDPNS/D Rev. 2, 4/2002

MPC755 Part Number Specification for the XPC755BxxnnnLD and XPC745BxxnnnLD Series

Motorola Part Numbers Affected:

XPC755BRX300LD XPC755BRX350LD XPC755BRX400LD XPC755BPX300LD XPC755BPX350LD XPC755BPX400LD XPC745BPX300LD XPC745BPX350LD



MOTOROLA intelligence everywhere^{**}

digital dna

This document describes part-number-specific changes to recommended operating conditions and revised electrical specifications, as applicable, from those described in the general *MPC755 RISC Microprocessor Hardware Specifications* (order # MPC755EC/D).

Specifications provided in this document supersede those in the *MPC755 RISC Microprocessor Hardware Specifications*, Rev. 4 or later, for the part numbers listed in Table A only. Specifications not addressed herein are unchanged. Because this document is frequently updated, refer to http://www.motorola.com/semiconductors or to your Motorola sales office for the latest version.

Note that headings and table numbers in this document are not consecutively numbered. They are intended to correspond to the heading or table affected in the general hardware specification.

Part numbers addressed in this document are listed in Table A. For more detailed ordering information see Section 1.11.

Motorola	Operating Conditions		S	Significant Differences from		
Part Number	CPU Frequency	V _{DD}	Т _Ј (°С)	Hardware Specification		
XPC755BRX300LD	300 MHz	2.0 V ±100 mV	0 to 105	2.0 V/1.8 V I/O voltage supported, 2.5 V		
XPC755BRX350LD	350 MHz			I/O not supported; all nominal core voltages are 2.0 V ±100 mV; AC timing		
XPC755BRX400LD	400 MHz					different for processor bus and L2 bus interfaces; L2 bus interface AC timing
XPC755BPX300LD	300 MHz			not guaranteed in 1.8 V/2.0 V mode.		
XPC755BPX350LD	350 MHz					
XPC755BPX400LD	400 MHz					

Table A. Significant Differences from Hardware Specification by Part Number

Motorola	Opera	ating Condition	S	Significant Differences from
Part Number	CPU Frequency	V _{DD}	Т _Ј (°С)	Hardware Specification
XPC745BPX300LD	300 MHz	2.0 V ±100 mV		2.0 V/1.8 V I/O voltage supported,
XPC745BPX350LD	350 MHz			2.5 V I/O not supported; all nominal core voltages are 2.0 V \pm 100 mV; AC timing different for processor bus interface.

Table A. Significant Differences from Hardware Specification by
Part Number (continued)

Note: The X prefix in a Motorola PowerPC part number designates a "Pilot Production Prototype" as defined by Motorola SOP 3-13. These are from a limited production volume of prototypes manufactured, tested, and Q.A. inspected on a qualified technology to simulate normal production. These parts have only preliminary reliability and characterization data. Before pilot production prototypes may be shipped, written authorization from the customer must be on file in the applicable sales office acknowledging the qualification status and the fact that product changes may still occur while shipping pilot production prototypes.

There are currently no known errata for the part numbers addressed by this data sheet.

1.3 General Parameters

The following general parameters apply to all part numbers described herein:

Core power supply	2.0 V \pm 100 mV DC (nominal; see Table 3 for recommended operating conditions)
I/O power supply	 1.8 V ±100 mV dc (processor bus interface only; not supported on L2 interface), or 2.0 V ±100 mV dc (processor bus interface only; not supported on L2 interface), or 3.3 V ±165 mV dc (input thresholds are configuration pin selectable)

Note that part revisions prior to Rev. 2.8 (Rev. E) do not support core voltages down to 1.8 V.

1.4.1 DC Electrical Characteristics

All part numbers affected by this specification support 3.3 V and 1.8 V/2.0 V I/O voltages, but do not support 2.5 V I/O voltages. Table 2 describes the input threshold voltage settings. These settings apply to all device revisions prior to Rev. 2.8 (Rev. E), including all part numbers described herein. Note that the MPC745 does not provide an L2 interface.

BVSEL Signal	L2VSEL Signal	Processor Bus Interface Voltage	L2 Bus Interface Voltage
0	0	1.8 V or 2.0 V	1.8 V or 2.0 V
0	1	1.8 V or 2.0 V	3.3 V
1	0	3.3 V	1.8 V or 2.0 V
1	1	3.3 V	3.3 V

Table 2. Input Threshold Voltage Setting

Caution: The input threshold selection must agree with the $OV_{DD}/L2OV_{DD}$ voltages supplied.

Table 3 provides the recommended operating conditions for all device revisions prior to Rev. 2.8 (Rev. E), including all part numbers described herein.

Characterist	ic	Symbol	Recommended Value	Unit
Core supply voltage		V _{DD}	2.0 ±100 mV	V
PLL supply voltage		AV _{DD}	2.0 ±100 mV	V
L2 DLL supply voltage	L2AV _{DD}	2.0 ±100 mV	V	
Processor bus supply voltage	BVSEL = 0	OV _{DD}	1.8 ±100 mV or 2.0 ±100 mV	V
	BVSEL = 1	OV _{DD}	3.3 ±165 mV	V
L2 bus supply voltage	L2VSEL = 0	L2OV _{DD}	1.8 ±100 mV or 2.0 ±100 mV	V
	L2VSEL = 1	L2OV _{DD}	3.3 ±165 mV	V

Table 3. Recommended Operating Conditions

Note: These are the recommended and tested operating conditions. Proper device operation outside of these conditions is not guaranteed.

Table 6 provides the DC electrical specifications for all device revisions prior to Rev. 2.8 (Rev. E), including all part numbers described herein.

Table 6. DC Electrical Specifications

At recommended operating conditions (see Table 3)

Characteristic	Nominal Bus Voltage ¹	Symbol	Min	Max	Unit	Notes
Input high voltage (all inputs except	1.8/2.0	V _{IH}	0.65 imes (L2)OV _{DD}	(L2)OV _{DD} + 0.3	V	2,3
SYSCLK)	3.3	V _{IH}	2.0	(L2)OV _{DD} + 0.3	V	2,3
Input low voltage (all inputs except	1.8/2.0	V _{IL}	-0.3	0.35 imes (L2)OV _{DD}	V	2
SYSCLK)	3.3	V _{IL}	-0.3	0.8	V	
SYSCLK input high voltage	1.8/2.0	κν _{ih}	1.5	OV _{DD} + 0.3	V	
	3.3	ΚV _{IH}	2.4	OV _{DD} + 0.3	V	
SYSCLK input low voltage	1.8/2.0	ΚV _{IL}	-0.3	0.2	V	
	3.3	κν _{il}	-0.3	0.4	V	

MOTOROLA

MPC755 Part Number Specification for the XPC755BxxnnnLD and XPC745BxxnnnLD Series

Table 6. DC Electrical Specifications (continued)

At recommended operating conditions (see Table 3)

Characteristic	Nominal Bus Voltage ¹	Symbol	Min	Max	Unit	Notes
Output high voltage, I _{OH} = -6 mA	1.8/2.0	V _{OH}	(L2)OV _{DD} - 0.45	—	V	
	3.3	V _{OH}	2.4	_	V	
Output low voltage, I _{OL} = 6 mA	1.8/2.0	V _{OL}	_	0.45	V	
	3.3	V _{OL}	—	0.4	V	

Notes:

1. Nominal voltages; see Table 3 for recommended operating conditions.

2. For processor bus signals, the reference is OV_{DD}. L2OV_{DD} is the reference for the L2 bus signals.

3. Excludes test signals (LSSD_MODE, L1_TSTCLK, L2_TSTCLK) and IEEE 1149.1 boundary scan (JTAG) signals.

1.4.2.2 Processor Bus AC Specifications

All part numbers described herein have slower AC timing characteristics than later revisions of the part. The affected processor bus AC timing specifications are given in Table 10.

Table 10. Processor Bus AC Timing Specifications

At recommended operating conditions (see Table 3)

Parameter	Symbol	300, 350,	Unit	
raiameter	Symbol	Min	Max	Onic
Input Hold Times: All Inputs	t _{IXKH}	0.6	_	ns
Valid Times: All Outputs	t _{KHOV}	—	4.5	ns

1.4.2.4 L2 Bus AC Specifications

The AC timing characteristics of the L2 bus interface in 3.3 V mode are slower for parts affected by this specification than for later revisions of the part. Additionally, the AC timing of the L2 interface is not guaranteed in 1.8 V/2.0 V mode. These affect the following part numbers only:

- XPC755BRX300LD
- XPC755BRX350LD
- XPC755BRX400LD
- XPC755BPX300LD
- XPC755BPX350LD
- XPC755BPX400LD

Table 12 provides the L2 bus interface AC timing specifications for the MPC755 described in this document when the L2 bus interface is in 3.3 V mode only. The L2 bus interface of the part described herein is not tested in 1.8 V/2.0 V mode and does not meet these specifications. The L2 interface output drivers may display a non-linear, stepped behavior when switching that prolongs the rise and fall times in this mode. This behavior is dependent on $L2OV_{DD}$, the impedance of the circuit board, and operating conditions of the processor. In a worst-case device, at $L2OV_{DD} = 1.8$ V and $T_j = 105^{\circ}$ C, the driver output impedance is 55 Ω ; at $L2OV_{DD} = 2.0$ V and $T_j = 105^{\circ}$ C, the driver output impedance is 47 Ω . The non-linear behavior results

when the driver output impedance is greater than the board impedance and can cause reflected wave switching instead of incident wave switching. The voltage level at which the step will occur is $V_{step} = L2OV_{DD} \times [Z_{board} / (Z_{out} + Z_{board})]$. If V_{step} is less than the input high threshold voltage of the SRAM, the SRAM will not recognize a logical high on a given signal until the reflected wave arrives. The time delay between the arrival of the incident wave and the reflected wave is determined solely by the propagation delay of the signal. Because of these issues, Motorola does not recommend or support the use of the L2 bus interface of the affected part numbers described herein in 1.8 V/2.0 V mode.

Parameter	Symbol	300 MHz		350 MHz		400 MHz		Unit	Notes
i arameter	Symbol	Min	Max	Min	Max	Min	Max	onic	Notes
Setup Times: Data and parity	t _{DVL2CH}	1.5	_	1.5	_	1.5	_	ns	2
Input Hold Times: Data and parity	t _{DXL2CH}	0.5	—	0.5		0.5	-	ns	2
Valid Times: All outputs when L2CR[14–15] = 00 All outputs when L2CR[14–15] = 01 All outputs when L2CR[14–15] = 10 All outputs when L2CR[14–15] = 11	t _{L2CHOV}		3.6 3.8 4.0 4.2		3.6 3.8 4.0 4.2		3.6 3.8 4.0 4.2	ns	3, 4
L2SYNC_IN to high impedance: All outputs when L2CR[14–15] = 00 All outputs when L2CR[14–15] = 01 All outputs when L2CR[14–15] = 10 All outputs when L2CR[14–15] = 11	t _{L2CHOZ}		3.5 4.0 4.2 4.5	 	3.5 4.0 4.2 4.5		3.5 4.0 4.2 4.5	ns	3, 5

Table 12. L2 Bus Interface AC Timing Specifications

At recommended operating conditions (see Table 3)

Notes:

2. All input specifications are measured from the midpoint of the signal in question to the midpoint voltage of the rising edge of the input L2SYNC_IN. Input timings are measured at the pins.

3. All output specifications are measured from the midpoint voltage of the rising edge of L2SYNC_IN to the midpoint of the signal in question. The output timings are measured at the pins. All output timings assume a purely resistive 50-Ω load.

 The outputs are valid for both single-ended and differential L2CLK modes. For pipelined registered synchronous BurstRAMs, L2CR[14–15] = 01 or 10 is recommended. For pipelined late write synchronous BurstRAMs, L2CR[14–15] = 11 is recommended.

5. Guaranteed by design and characterization.

1.10 Ordering Information

1.10.1 Part Numbers Addressed by This Specification

Table 20 provides the ordering information for the MPC755 parts described in this specification.

XPC	XXX	В	XX	nnn	X	X
Product Code	Part Identifier	Process Descriptor	Package	Processor Frequency ¹	Application Modifier	Revision Level
XPC ²	755 745	B = HiP4DP	PX = PBGA RX = CBGA	300 350 400	L: 2.0 V ±100 mV 0° to 105°C	D: 2.7; PVR = 0008 3203

Table 20. Part Numbering Nomenclature


Notes:

1. Processor core frequencies supported by parts addressed by this specification only. Parts addressed by other specifications may support other maximum core frequencies.

2. The X prefix in a Motorola part number designates a "Pilot Production Prototype" as defined by Motorola SOP 3-13. These are from a limited production volume of prototypes manufactured, tested, and Q.A. inspected on a qualified technology to simulate normal production. These parts have only preliminary reliability and characterization data. Before pilot production prototypes may be shipped, written authorization from the customer must be on file in the applicable sales office acknowledging the qualification status and the fact that product changes may still occur while shipping pilot production prototypes.

1.10.3 Part Marking

Parts are marked as the example shown in Figure 29.

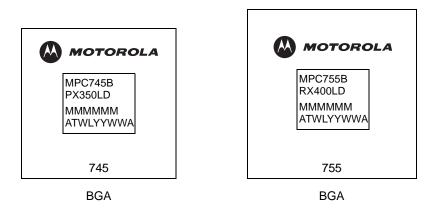

Notes:

MMMMMM is the 6-digit mask number.

ATWLYYWWA is the traceability code.

CCCCC is the country of assembly. This space is left blank if parts are assembled in the United States.

Figure 29. Part Marking for BGA Device

Document Revision History

Table B provides a revision history for this hardware specification.

Revision No.	Substantive Change(s)			
0–1	Initial releases.			
2	Updated document.			
	Corrected Section 1.4.2.4.			

Table B. Document Revision History

HOW TO REACH US:

USA/EUROPE/LOCATIONS NOT LISTED:

Motorola Literature Distribution P.O. Box 5405, Denver, Colorado 80217 1-303-675-2140 or 1-800-441-2447

JAPAN:

Motorola Japan Ltd. SPS, Technical Information Center 3-20-1, Minami-Azabu Minato-ku Tokyo 106-8573 Japan 81-3-3440-3569

ASIA/PACIFIC:

Motorola Semiconductors H.K. Ltd. Silicon Harbour Centre, 2 Dai King Street Tai Po Industrial Estate, Tai Po, N.T., Hong Kong 852-26668334

TECHNICAL INFORMATION CENTER:

1-800-521-6274

HOME PAGE:

http://www.motorola.com/semiconductors

DOCUMENT COMMENTS:

FAX (512) 933-2625 Attn: RISC Applications Engineering Information in this document is provided solely to enable system and software implementers to use Motorola products. There are no express or implied copyright licenses granted hereunder to design or fabricate any integrated circuits or integrated circuits based on the information in this document.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters which may be provided in Motorola data sheets and/or specifications can and do vary in different applications and actual performance may vary over time. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part.



Motorola and the Stylized M Logo are registered in the U.S. Patent and Trademark Office. digital dna is a trademark of Motorola, Inc. All other product or service names are the property of their respective owners. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer. © Motorola, Inc. 2002

MPC755BLDPNS/D