









Model Number


RL28-8-H-400-RT-Z/49/116

Background suppression sensor with terminal compartment


Features

- Ultra bright LEDs for power on and switching state
- Good alignability due to red transmission LED
- Programmable time function GAN, GAB, IAB and GAN-IAB as double function
- Not sensitive to ambient light, even with switched energy saving lamps
- Waterproof, protection degree IP67
- Protection class II

Dimensions

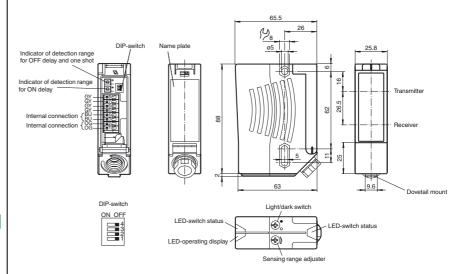

Electrical connection

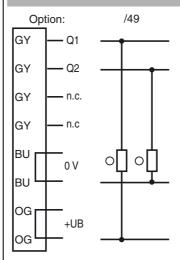

- O = Light on
- = Dark on

www.pepperl-fuchs.com

Technical data		
General specifications		
Detection range		20 400 mm
Detection range min.		20 150 mm
Detection range max.		20 400 mm
Background suppression		max. + 10 % of the upper limit of the detection range
Light source		LED
Light type		modulated visible red light , 660 nm
Black/White difference (6 %/90 %	%)	< 10 %
Diameter of the light spot	-,	approx. 12 mm at a distance of 400 mm
Angle of divergence		Emitter 1.2°,
		Receiver 2°
Ambient light limit		50000 Lux
Functional safety related param	neters	
MTTF _d		1130 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operating display		LED green
Function display		2 LEDs yellow
r anotion diopicy		ON: object inside the scanning range OFF: object outside the scanning range
Controls		Light/Dark switch
Controls		Detection range adjuster
Electrical specifications		
Operating voltage	U_{B}	10 30 V DC
Ripple		10 %
No-load supply current	I ₀	≤ 40 mA
Output	•	
Switching type		light/dark on, switchable (selectable, light/dark switching is only activated if the receiver has 'dark on' selected.)
Signal output		1 NPN, 1 PNP synchronized-switching, short-circuit protected, reverse polarity protected , open collectors
Switching voltage		max. 30 V DC
Switching current		max. 200 mA
Switching frequency	f	250 Hz
Response time		2 ms
Timer function		ON delay (GAN), OFF delay (GAB), one shot (IAB), ON delayone shot (GAN-IAB), ON delay-OFF delay (GAN-GAB), programmable adjustment interval 0.02 s 1 s
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 75 °C (-40 167 °F)
Mechanical specifications		
Protection degree		IP67
Connection		terminal compartment with 8 spring-loaded terminals for wire cross section 0.5 1.5 mm[Hoch]2[Hoch], insulation stripping 7.5 8.5 mm, M16 x 1.5 cable gland
Material		
Housing		Plastic ABS
Optical face		plastic
Mass		112 g
Compliance with standards and ves	directi	-
Standard conformity		
Product standard		EN 60947-5-2:2007
Approvals and certificates		
Protection class		II, rated voltage ≤ 250 V AC with pollution degree 1-2 according to IEC 60664-1 Caution! The protection class 2 is only valid when the terminal com-
III ammunii-l		partment is closed.
UL approval		cULus
CCC approval		Products with a maximum operating voltage of ≤36 V do not bear a CCC marking because they do not require approval.

Accessories

OMH-05

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-07

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-21

Mounting bracket

OMH-22

Mounting bracket

OMH-MLV11-K

dove tail mounting clamp

OMH-RLK29

Mounting bracket

OMH-RLK29-HW


Mounting bracket for rear wall mounting


OMH-RL28-C

Protective cover


Other suitable accessories can be found at www.pepperl-fuchs.com

Curves/Diagrams

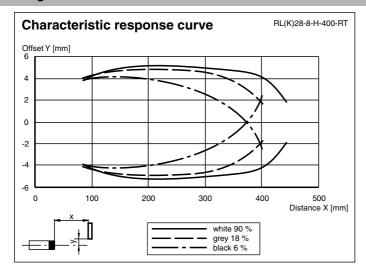

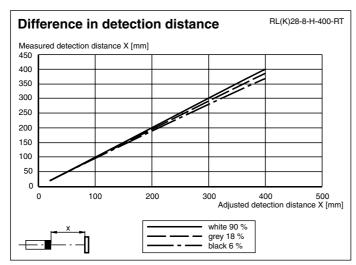

Timer functions

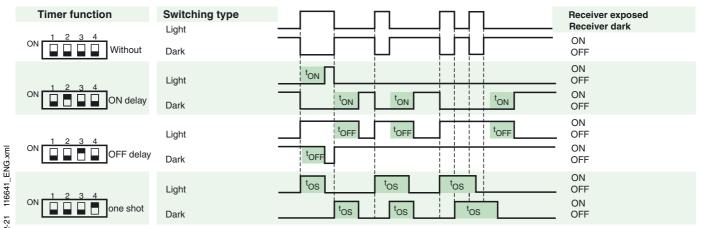

Time t_{ON} , t_{OFF} and t_{OS} are adjustable from 0.02 to 1 seconds. The Light-/Dark-Switch (Left, outer switch) is shown in the "Dark ON" position.

Туре	Description	Notes
-Z	OFF delay timer	Adjustable time interval
	one shot timer	(0.02 s - 10 s)
	ON delay timer	
	ON delay timer / OFF delay timer	
	ON delay timer / one shot timer	

fa-info@sg.pepperl-fuchs.com

www.pepperl-fuchs.com

Additional information

Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

Mounting instructions:

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

Adjustment:

After the operating voltage is applied, the LED is lit green.

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

Object direction:

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.