









Model Number


RL28-8-H-400-FFP-3019/47/115b

Background suppression sensor with 0.2 m fixed cable and 4-pin, M12 connector


Features

- Special range of application: Specialised fine positioning
- Ultra bright LEDs for power on and switching state
- Good alignability due to red transmission LED
- Not sensitive to ambient light, even with switched energy saving lamps
- Protection class II

Dimensions

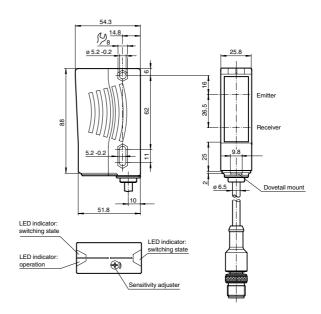

Electrical connection

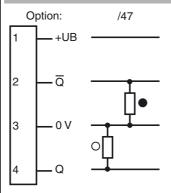

- O = Light on
- = Dark on

Pinout



www.pepperl-fuchs.com

Technical data		
General specifications		
Detection range		20 400 mm
Detection range min.		20 150 mm
Detection range max.		20 400 mm
Background suppression		max. + 10 % of the upper limit of the detection range
Light source		LED
Light type		modulated visible red light, 660 nm
Black/White difference (6 %/90 %	6)	< 15 %
Diameter of the light spot	,	4 mm x 4 mm at a distance of 250 mm
Angle of divergence		Emitter 1.2°, Receiver 2°
Ambient light limit		50000 Lux
Functional safety related param	eters	
MTTF _d		1130 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operating display		LED green
Function display		LEDs yellow ON: object inside the scanning range
Controls		OFF: object outside the scanning range
		Detection range adjuster
Electrical specifications		40 00 V DO
Operating voltage	U _B	10 30 V DC 10 %
Ripple No-load supply current		10 % ≤ 40 mA
''' /	I ₀	≤ 40 IIIA
Output		liabildout on
Switching type		light/dark on 2 PNP, complementary, short-circuit protected, reverse polarity
Signal output		protected , open collectors max. 30 V DC
Switching voltage		max. 200 mA
Switching current	f	250 Hz
Switching frequency Response time	'	2 ms
•		2 IIIS
Ambient conditions		40 00 °C (40 140 °F)
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 75 °C (-40 167 °F)
Mechanical specifications		1007
Protection degree		IP67
Connection		0.2 m fixed cable with 4-pin, M12 connector
Material		Plastic ABS
Housing Ontical face		
Optical face Mass		plastic
	l dive et	70 g
Compliance with standards and ves	airect	I*
Standard conformity		EN 60047 5 0,0007
Product standard		EN 60947-5-2:2007 IEC 60947-5-2:2007
Approvals and certificates		
Protection class		II, rated voltage \leq 250 V AC with pollution degree 1-2 according to IEC 60664-1
UL approval		cULus
CCC approval		Products with a maximum operating voltage of ≤36 V do not bear a CCC marking because they do not require approval

Accessories

OMH-05

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-21

Mounting bracket

OMH-22

Mounting bracket

OMH-MLV11-K

dove tail mounting clamp

OMH-RLK29

Mounting bracket

OMH-RLK29-HW

Mounting bracket for rear wall mounting

OMH-RL28-C


Protective cover


Other suitable accessories can be found at www.pepperl-fuchs.com

PEPPERL+FUCHS

bear a CCC marking because they do not require approval.

Curves/Diagrams

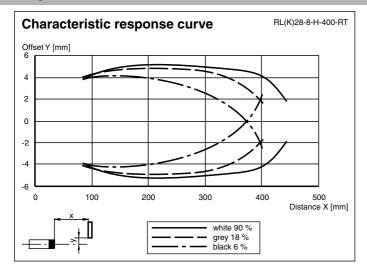

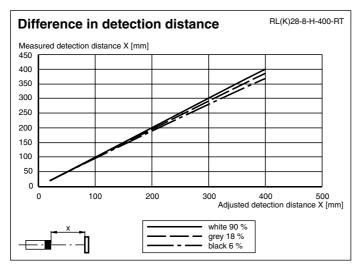

Additional information

Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

Mounting instructions:

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

Adjustment:

After the operating voltage is applied, the LED is lit green.

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

Object direction:

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.

fa-info@pepperl-fuchs.com